

proceq

equotip[®]
Operating Instructions



Swiss Precision since 1954

Table of Contents

| | | | |
|---|-----------|---|-----------|
| 1. Safety and Liability | 4 | 5.2 Verifications..... | 30 |
| 1.1 General Information..... | 4 | 5.3 Mappings..... | 30 |
| 1.2 Liability..... | 4 | 6. Wizards..... | 31 |
| 1.3 Safety Instructions..... | 4 | 6.1 Measurement Wizard | 31 |
| 1.4 Correct Usage..... | 4 | 6.2 Device Verification..... | 31 |
| 1.5 Optimizing Performance of the Battery System..... | 4 | 6.3 Impact Direction Calibration (Leeb only)..... | 32 |
| 2. Getting Started | 5 | 6.4 Conversion Curve Creation | 32 |
| 2.1 Installation | 5 | 6.5 Combined Method..... | 34 |
| 2.2 Main Menu..... | 6 | 6.6 Mapping Wizard..... | 34 |
| 3. Measurement | 7 | 7. Information..... | 35 |
| 3.1 Performing Measurements | 7 | 7.1 Documents..... | 35 |
| 3.2 Measurements Screen..... | 10 | 7.2 Upload PDF-Files from an USB-stick..... | 35 |
| 3.3 Measuring Methods | 12 | 8. System..... | 36 |
| 3.4 Instrument Verification / Daily Performance Check | 24 | 8.1 Features..... | 36 |
| 3.5 Use of barcode scanners..... | 24 | 8.2 Probes | 37 |
| 4. Settings | 25 | 8.3 Hardware..... | 37 |
| 4.1 Measurements | 25 | 8.4 Date & Time..... | 37 |
| 4.2 Verification (Performance & Uncertainty Check) | 27 | 8.5 Language..... | 37 |
| 4.3 Conversions (Hardness Conversions) | 28 | 8.6 Device information..... | 37 |
| 4.4 Reporting..... | 28 | 9. Maintenance and Support | 38 |
| 5. Data (Explorer) | 29 | 9.1 Maintenance..... | 38 |
| 5.1 Measurements | 29 | 9.2 Support Concept | 39 |

| | | | | | |
|------------|--|-----------|------|---|-----------|
| 9.3 | Standard Warranty and Extended Warranty..... | 39 | 13. | Standards & Guidelines | 47 |
| 9.4 | Disposal..... | 39 | 14. | Ordering Information | 48 |
| 10. | Troubleshooting | 40 | 14.1 | Units..... | 48 |
| 10.1 | Incorrect Measurements / Failed Performance Check..... | 40 | 14.2 | Impact Devices & Probes | 49 |
| 10.2 | No Reading Displayed | 41 | 14.3 | Parts and Accessories | 49 |
| 10.3 | Battery | 42 | 14.4 | Test Blocks..... | 50 |
| 10.4 | Touchscreen Calibration..... | 42 | | | |
| 11. | Equotip Link Software | 42 | | | |
| 11.1 | Starting Equotip Link..... | 42 | | | |
| 11.2 | Application Settings | 42 | | | |
| 11.3 | Connecting to an Equotip 550 Touchscreen Unit | 43 | | | |
| 11.4 | Connection to Portable Rockwell Probe..... | 43 | | | |
| 11.5 | Adjusting the Settings | 43 | | | |
| 11.6 | Exporting Data..... | 44 | | | |
| 11.7 | Exporting and Importing of Setting Profiles..... | 45 | | | |
| 11.8 | Exporting and Importing of Conversion Curves | 45 | | | |
| 12. | Technical Specifications..... | 45 | | | |
| 12.1 | Instrument | 45 | | | |
| 12.2 | Power Supply..... | 46 | | | |
| 12.3 | Equotip Leeb Impact Devices | 46 | | | |
| 12.4 | Equotip Portable Rockwell Probe..... | 47 | | | |
| 12.5 | Equotip UCI Probe..... | 47 | | | |

1. Safety and Liability

1.1 General Information

This manual contains important information on the safety, use and maintenance of the Equotip 550. Read through the manual carefully before the first use of the instrument.

1.2 Liability

Our “General Terms and Conditions of Sales and Delivery” apply in all cases. Warranty and liability claims arising from personal injury and damage to property cannot be upheld if they are due to one or more of the following causes:

- Failure to use the instrument in accordance with its designated use as described in this manual.
- Incorrect performance check for operation and maintenance of the instrument and its components.
- Failure to adhere to the sections of the manual dealing with the performance check, operation and maintenance of the instrument and its components.
- Unauthorised modifications to the instrument and its components.
- Serious damage resulting from the effects of foreign bodies, accidents, vandalism and force majeure.

All information contained in this documentation is presented in good faith and believed to be correct. Proceq SA makes no warranties and excludes all liability as to the completeness and/or accuracy of the information.

1.3 Safety Instructions

The equipment is not allowed to be operated by children or anyone under the influence of alcohol, drugs or pharmaceutical preparations. Anyone who is not familiar with this manual must be supervised when using the equipment.

- Carry out the stipulated maintenance properly and at the correct time.
- Following completion of the maintenance tasks, perform a functional check.

1.4 Correct Usage

The instrument is only to be used for its designated purpose as described herein.

- Replace faulty components only with original replacement parts from Proceq.
- Accessories should only be installed or connected to the instrument if they are expressly authorized by Proceq. If other accessories are installed or connected to the instrument then Proceq will accept no liability and the product guarantee is forfeited.

1.5 Optimizing Performance of the Battery System

To increase the performance of the battery, it is recommended to first completely discharge and then completely charge it.

2. Getting Started

The Equotip 550 is typically used for testing the hardness of metallic surfaces. The user has a choice to select either Leeb rebound, the Portable Rockwell or UCI principle, see chapter “3.1 Performing Measurements”.

In combination with the Equotip Leeb Impact Device U the instrument is used to test the roll hardness of paper, film or foil rolls.

2.1 Installation

To install the Battery into the Equotip 550 Touchscreen Unit, lift the stand as shown, insert the battery and fasten it in place with the screw.



Figure 1: Insert Battery

There are three status LEDs on the right side of the display. The middle light is the power indicator which is red when charging and turns to green when battery is fully charged. The lower LED is used for application specific notification.



NOTE! Only use the battery charger provided for charging.

- A complete charge requires < 9 h (Instrument not operating)
- Charging time is much longer if the instrument is in use.
- An optional Quick Charger (Part No. 327 01 053) can be used to charge a spare battery or to charge the battery outside of the instrument. In this case it takes < 5.5 h for a complete charge.

Buttons

On the upper right of the unit there are three buttons:



Power On/Off – Press to power on or to return to the home screen. Press and hold to power off.



Soft Key – Switches in and out of full screen view or toggles between the actual screen and the last viewed pdf document (eg. Operating Instructions).



Back Button – Returns to previous screen.

Energy Saving

Energy saving may be programmed as desired under System/Power settings, see chapter “8.3 Hardware”.

Connections



1 2
Snap-in connectors



USB Host
USB Device
Ethernet
Power Supply

Figure 2: Connections

For Leeb Impact Devices

use the Snap-in connector 1.

For UCI Probes

use the Snap-in connectors 1 or 2.

For the Portable Rockwell Probe

use the USB Host connector.

USB Host:

Additionally connect a mouse, keyboard, barcode scanner or USB stick.

USB Device:

Connect to PC.

Ethernet:

Connection to network.

Power Supply:

Connect the power supply through this connection.

2.2 Main Menu

On start up the main menu is displayed. All functions may be accessed directly via the Touchscreen. Return to the previous menu by pressing the back button or the return icon (arrow) at the top left corner of the Touchscreen.

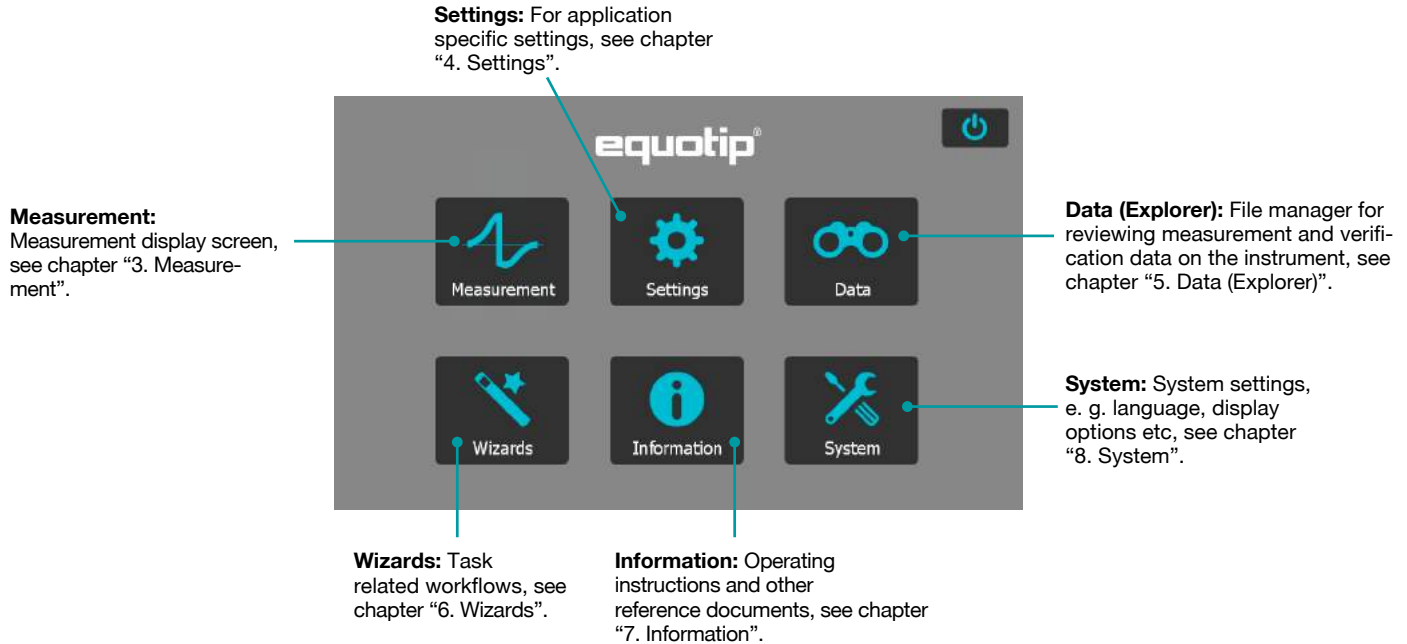


Figure 3: Main Menu

3. Measurement

3.1 Performing Measurements

3.1.1 Leeb Testing Procedure (except Leeb U)

Select automatic compensation for impact direction “Automatic”, see chapter “3.2.1 Controls”. If “Automatic” is not allowed, set the impact direction ($\downarrow \rightarrow \nearrow \uparrow$). The Equotip Leeb Impact Devices DL doesn’t support automatic mode. The impact direction must be selected manually. Select the appropriate material group, hardness scales and number of impacts per measurement series. For more information see chapter “4. Settings”. Conduct impacts by cycling through “load, position and trigger” mechanism:



1. **Load** the impact device – while not in contact with the test piece – by holding it firmly with one hand and sliding the loading tube with the other hand until contact is grabbed by the clutch.
2. **Position** the support ring on the test piece. Take particular care to fully position the support ring on the test piece, but not coinciding with a previous test indentation.
3. To **trigger** an impact, press the trigger button to release the impact body. To perform another impact, repeat this cycle.

Figure 4: Leeb Testing Procedure

After the last of the impacts is performed, the hardness average and further statistics of the measurement series are displayed.



NOTE! Make sure the loading tube is allowed to slowly return back to the starting position. Do take care so the loading tube does not spring back uncontrolled, which may result in permanent device damage.



NOTE! If possible, follow the standard practice of Leeb rebound hardness testing as described in the standards ISO 16859-1 (metallic materials), ASTM A956 (steel, cast steel and cast iron only), or other applicable standards. If these are not available, the user is recommended to average a minimum of $n = 3$ impacts at an indentation distance of 3 to 5 mm (0.12 to 0.20”) for each location of the sample that shall be tested.



NOTE! Do not carry out an impact in an area that has already been deformed by another impact. Also, do not load the device when it is already positioned in the new test location, since the material under the device may be affected through prior stress, and the catch chuck of the device may get damaged.

3.1.2 Portable Rockwell Testing Procedure



1. **Place** the probe on the sample to test. For flat surfaces the standard foot is most suitable. For cylindrical objects it is recommended to use one of the special feet. For locations difficult to access a tripod foot can be used. See chapter “14. Ordering Information” for more details.



2. **Press** the probe slowly but firmly against the surface to perform the measurement. Suppress vibrations as much as possible, and follow the instructions on the screen.
3. **Release** the probe when the instrument says so. Again, this movement has to be done in a controlled manner. If the probe is released too fast, a warning will be shown and the measurement should be repeated.

Figure 5: Portable Rockwell Testing Procedure

3.1.3 UCI Testing Procedure



1. **Place** the probe on the sample to test. The probe must be perpendicular to the surface ($\pm 5^\circ$). The special foot can be used to increase repeatability and reduce distortion of the results, see chapter “14. Ordering Information”.



2. **Press** the probe slowly but firmly against the surface until the selected measuring force is reached. The instrument will indicate when to release the probe with an on-screen prompt and audible sound.
3. **Release** the probe from the material. It is important to remove the probe completely from the test object. Otherwise the results can be biased.

Figure 6: UCI Testing Procedure



NOTE! A warning will be shown if the user applied too much load when pressing the probe against the surface. Please avoid frequent overloading, as this could seriously damage the probe.

3.1.4 Leeb U Testing Procedure

The Equotip 550 Leeb U enables the user to quickly and precisely diagnose roll imperfections, hardness inconsistencies and uneven winding, thereby preventing problems for printing and converting operations.

With Equotip Impact Device Leeb U automatic impact direction mode is not supported and the user must select the appropriate impact direction manually (90° down, 45° down, 0°).

As for roll hardness testing no conversion curves are used, no material group has to be selected.

Conduct impacts by cycling through “position and trigger”.



1. **Position** the probe on the roll to be tested. Make sure to fully position the support ring on the roll to ensure an impact perpendicular to the test surface.
2. While holding the impact device firmly with two hands, slide the loading tube smoothly down to load and **trigger** an impact.

Move the impact device to the next point on the roll and repeat.

Figure 7: Leeb U Testing Procedure



NOTE! Some features mentioned in this Operating Instructions are specifically addressing metal hardness testing applications and therefore not available for Equotip Leeb U.

3.2 Measurements Screen

3.2.1 Controls

File Name: Enter the file name and tap return. Saved measurements will be stored automatically. If filename management is activated, this function is locked.

Measurement Mode: Switch between measurement and conversion.

Time and battery status

Impact Direction: To manually set the impact direction if required (Leeb only, by default this is automatic).



Material: Select the material group to use for conversions (not available for Leeb U).

Measurement Scale: Select the hardness scale (primary and secondary) to be displayed (not available for Leeb U).

Wizards: Direct access to wizards.

Redo: Restart the measurement series or a single measurement.

Delete: Delete the last measurement.

Save: Store measurement data.

Settings: direct shortcut to settings menu.

Figure 8: Measurement Screen

3.2.2 Measurement Views



Figure 9: Measurement Views

Equotip 550 is fully customizable as a device and can display three different measurement views simultaneously. Each view can be switched to meet the user's requirements by simply clicking on the icon related to the particular display at the top right corner of each screen.



Signal View: Display the probe signal from the last active measurement. This may be useful for advanced evaluations.



Statistic View: View statistics for the active measurement series. Number of impacts (n), Average (\bar{x}), Standard deviation (σ), Minimum/Maximum (\updownarrow) and Range (\pounds) are displayed in the primary scale.



Table View: Display the measurements for the active series in a table format.




Conversion View: Display the actual value on the conversion curve.



Bar View: Display the measurements of the series as a histogram.



Profile View: Display the measurement results as a profile.

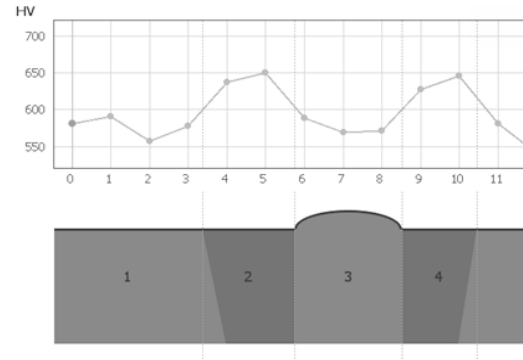

Info: Display the measurement settings e.g. series length, probe type, material group etc.



User's View: Six customizable information fields are shown. Tap each field to configure its content and scale.



Single Record View: Display the last or selected measurement result in both the primary and secondary hardness scales.



Sample ID's: Shows and defines the custom fields.



NOTE! Screen views cannot be duplicated.

3.3 Measuring Methods

Equotip 550 family of instruments is capable of accepting three different test methods using a single indicating unit.

3.3.1 Equotip Leeb

3.3.1.1 Test Principle

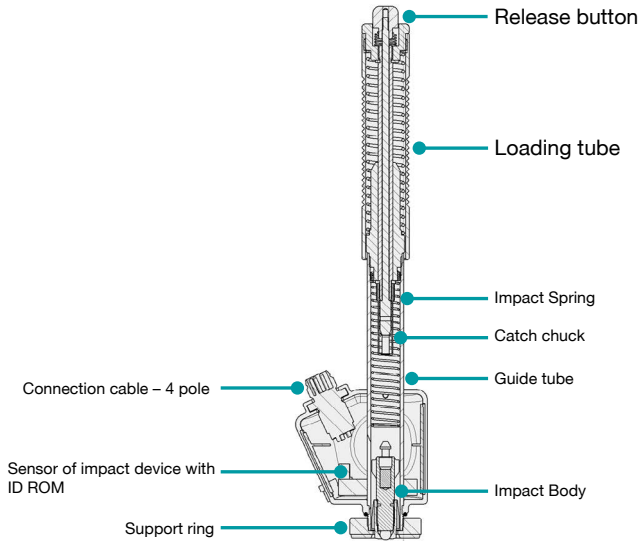


Figure 10: Schematic View of a Leeb Impact Device

During measurement with Equotip 550 impact devices (D, DL, DC, C, G, S, and E); an impact body with a ball indenter is launched by spring

energy against the sample to be measured, and then rebounds. Before and after the impact, a permanent magnet inside the impact body passes through a coil in which a voltage signal is induced by the forwards and backwards movement. This induction signal behaves proportionally to the velocities. The ratio of the rebound velocity v_r to the impact velocity v_i multiplied by 1000 yields the hardness value HL (Leeb hardness). HL is a direct measure of the hardness. The third resp. fourth letter of the HL unit refers to the impact device HLD → D impact device.

$$HL = \frac{v_r}{v_i} \cdot 1000$$

Equotip Leeb U

Although the Equotip Leeb Impact Device U is constructed differently to simplify the measurement process, the underlying principle is the same.



Figure 11: Equotip Leeb U Impact Device

Existing Parotester impact devices type U are fully supported by the Equotip 550. Typ P and PG impact devices can be still used, but the unit is shown as HLU although it would be actually LP resp. LPG.



NOTE! HLU values can be directly compared to LU on existing Parotester instruments.

3.3.1.2 Sample Preparations

Keep the sample free of vibrations during the test. Light and thin parts must be specially fastened, see chapter “3.3.1.6 Testing Light Samples”. Ensure that the surface of the work piece is clean, smooth and dry. If required, use appropriate cleaning agents for cleaning, such as acetone or isopropanol. Do not use water or any other detergent fluids.



NOTE! Please use the surface roughness comparator plate provided to estimate the average roughness of the test piece prior to testing.



Figure 12: Surface Roughness Comparator Plate

3.3.1.3 Standards

Brief descriptions of referenced standards:

- DIN 50156** Leeb hardness testing of metallic materials (obsolete)
- ASTM A956** Standard test method for Leeb hardness testing of steel products
- ASTM A370** Test methods and definitions for mechanical testing of steel products
- ASTM E140** Standard hardness conversion tables for metals relationship among Brinell, Vickers, Rockwell, Superficial, Knoop, Scleroscope and Leeb hardness
- ISO 18265** Metallic materials – Conversion of hardness values
- ISO 16859** Leeb hardness testing of metallic materials

3.3.1.4 Test Conditions

To ensure proper hardness readings, the following conditions must be fulfilled. If one or more conditions are not met, the measurement result may be significantly false.

| Impact device type | | D/DC/DL/S/E | G | C | |
|----------------------------------|--|----------------------|--------------|--------------|--------------|
| Surface preparation | Roughness grade class ISO 1302 | N7 | N9 | N5 | |
| | Max. roughness depth R _a (µm / µinch) | 10 / 400 | 30 / 1200 | 2.5 / 100 | |
| | Average roughness R _a (µm / µinch) | 2 / 80 | 7 / 275 | 0.4 / 16 | |
| Minimum sample mass | Of compact shape (kg / lbs) | 5 / 11 | 15 / 33 | 1.5 / 3.3 | |
| | On solid support (kg / lbs) | 2 / 4.5 | 5 / 11 | 0.5 / 1.1 | |
| | Coupled on plate (kg / lbs) | 0.05 / 0.2 | 0.5 / 1.1 | 0.02 / 0.045 | |
| Minimum sample thickness | Uncoupled (mm / inch) | 25 / 0.98 | 70 / 2.73 | 15 / 0.59 | |
| | Coupled (mm / inch) | 3 / 0.12 | 10 / 0.4 | 1 / 0.04 | |
| | Surface layer thickness (mm / inch) | 0.8 / 0.03 | | 0.2 / 0.008 | |
| Minimum space | Between indentation and sample edge (mm/inch) | 5 / 0.2 | 8 / 0.3 | 4 / 0.16 | |
| | Between indentations (mm/inch) | 3 / 0.12 | 4 / 0.16 | 2 / 0.08 | |
| Indentation size on test surface | With 300 HV, 30 HRC | Diameter (mm / inch) | 0.54 / 0.021 | 1.03 / 0.04 | 0.38 / 0.015 |
| | | Depth (µm / µinch) | 24 / 960 | 53 / 2120 | 12 / 480 |
| | With 600 HV, 55 HRC | Diameter (mm / inch) | 0.45 / 0.017 | 0.9 / 0.035 | 0.32 / 0.012 |
| | | Depth (µm / µinch) | 17 / 680 | 41 / 1640 | 8 / 2560 |
| | With 800 HV, 63 HRC | Diameter (mm / inch) | 0.35 / 0.013 | | 0.30 / 0.011 |
| | | Depth (µm / µinch) | 10 / 400 | | 7 / 280 |

Table 1: Leeb Test Piece Requirements

3.3.1.5 Selecting the Equotip Leeb Impact Device

For optimized testing of diverse metallic materials and sample geometries, a range of impact devices are available as per “Table 1: Leeb Test Piece Requirements”.

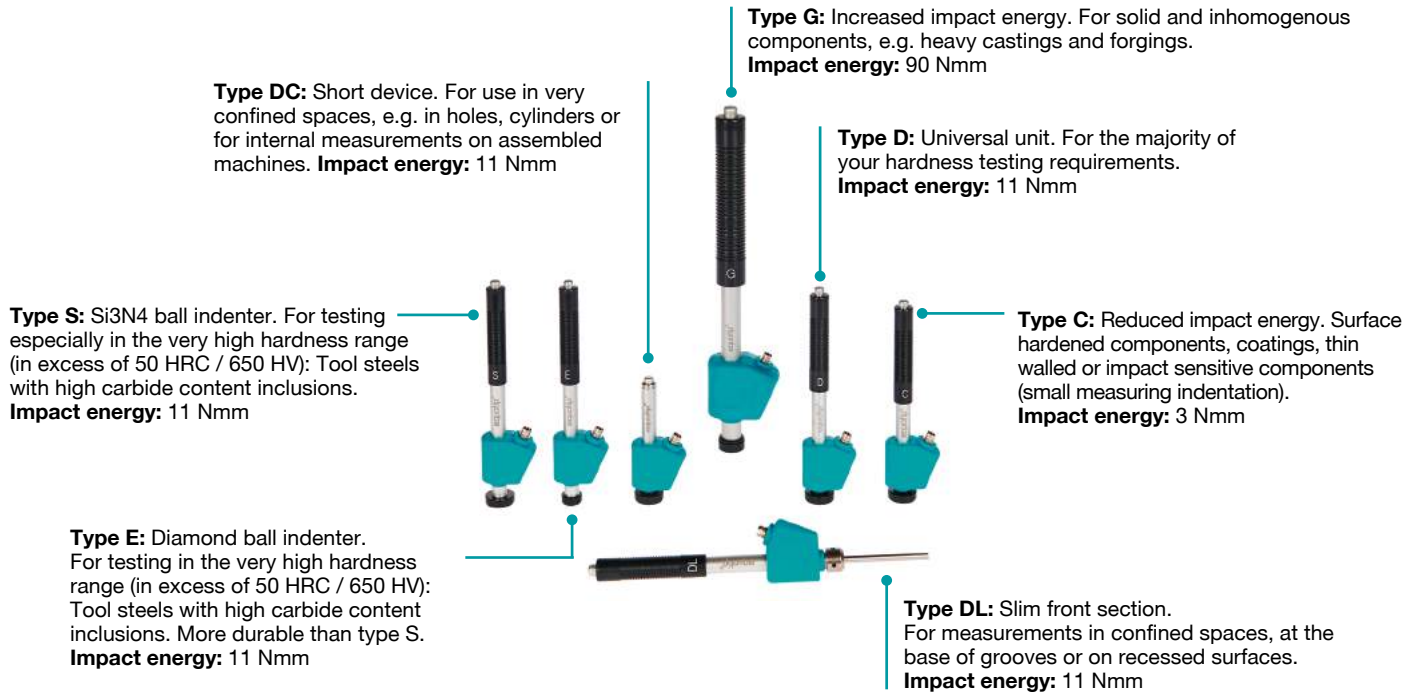


Figure 13: Equotip Leeb Impact Devices

3.3.1.6 Testing Light Samples

If the samples are lighter than specified in chapter “3.3.1.4 Test Conditions” or sample sections have unfavorable mass distribution they can vibrate as the impact body hits the test point. This results in unwanted energy absorption. Such samples shall be supported by solid worktops. If the mass falls below the specific requirements but still exceeds the coupling amount then coupling it to a larger mass can help prevent vibrations.

The following requirements must be met for coupling:

- The contact surface of the sample and the surface of the solid support must be level, flat and ground smooth.
- The sample must exceed the minimum sample thickness for coupling. Follow the coupling procedure.
- Apply a thin layer of coupling paste to the contact surface of the sample.
- Press the sample firmly against the support.
- Push the sample in a circular motion and carry out the impact as usual, perpendicular to the coupled surface.



NOTE! Clamping may strain the sample, which can affect the hardness readings.

3.3.1.7 Testing Curved Surfaces

The instrument works properly only when the ball indenter at the front of the impact body is precisely at the end of the tube at the time of the impact. When concave or convex surfaces are tested, the ball indenter does not entirely leave the test tube or comes out too far. In such cases, replace the standard support ring by a specially suited ring, see chapter “14. Ordering Information” or contact your local Proceq representative.

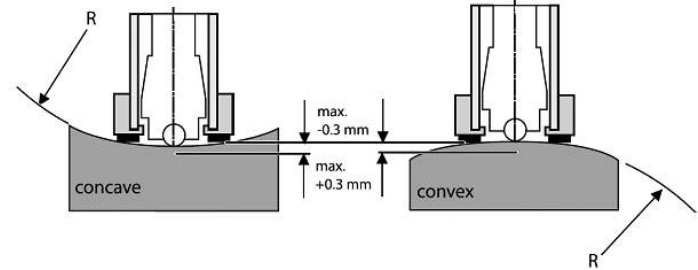


Figure 14: Leeb Testing on Curved Surfaces

3.3.1.8 Testing Thin Samples

Pipes and tubes sometimes have mass distributions that can affect the result of the Leeb hardness test due to vibration. During on-site testing of pipelines, for example the test locations cannot be supported by solid worktops or clamped.

To benefit from the convenience and speed of the Leeb test, the user can make use of a custom conversion after conducting the following calibration procedure, for example:

- Data pairs are measured on reference samples. For the Leeb HLDL reference measurements, it is crucial that they are done on parts that are installed in the same way as those to be tested on-site. For example, two pipe samples “Pipe type 5 mm Duplex soft” (730 HLDL / 255 HB) and “Pipe type 5 mm Duplex hard” (770 HLDL / 310 HB) are measured using the Equotip Leeb impact device DL and a Brinell tester, respectively.
- The original HLDL-HB conversion curve for “1 Steel and cast steel” is now adapted using the two data points. The detailed procedure on how to create custom conversion curves in the Equotip 550 is given in chapter “6.4 Conversion Curve Creation”.
- To measure “Pipe type 5 mm Duplex” in future, it can be selected via “Material” – “Pipe type 5 mm Duplex”, using the hardness scale “HB Brinell” also see chapter “6.4.3 Example of a Custom Conversion (Two-Point Method)”.



NOTE! The user needs to determine and qualify the adaptation of conversion curves for each tube diameter and wall thickness. Guides to the procedure are provided in Nordtest Technical Report Series 424, Reports 99.12/13 and ASME Final Report CRTD-91.



NOTE! It is important to include all the critical information about the geometry of the test sample.

3.3.1.9 Material Groups

No need to select any material when measuring in the native Leeb rebound scale HL as no conversion is applied. In contrast, hardness scale conversions are correct only when the appropriate material group is selected. Free online material databases and the Equotip 550 on-board reference documents can be useful to assign your materials to one of the default material groups. Suitability of conversions should be qualified on calibrated samples before use. For further information, please consult a Proceq representative.



NOTE! For a given test principle (native scale), the dropdown menu only lists the material groups for which conversions are available.



NOTE! If there is no conversion curve available, the user has the possibility to create its their own, see chapter “6.4 Conversion Curve Creation”.

| | | | D/DC | DL | S | E | G | C |
|---|---------------------|----------|----------|----------|----------|----------|----------|----------|
| Steel and cast steel | Vickers | HV | 81-955 | 80-950 | 101-964 | 84-1211 | | 81-1012 |
| | Brinell | HB | 81-654 | 81-646 | 101-640 | 83-686 | 90-646 | 81-694 |
| | Rockwell | HRB | 38-100 | 37-100 | | | 48-100 | |
| | | HRC | 20-68 | 21-68 | 22-70 | 20-72 | | 20-70 |
| | | HRA | | | 61-88 | 61-88 | | |
| | Shore | HS | 30-99 | 31-97 | 28-104 | 29-103 | | 30-102 |
| | RmN/mm ² | σ1 | 275-2194 | 275-2297 | 340-2194 | 283-2195 | 305-2194 | 275-2194 |
| σ2 | | 616-1480 | 614-1485 | 615-1480 | 616-1479 | 618-1478 | 615-1479 | |
| σ3 | | 449-847 | 449-849 | 450-846 | 448-849 | 450-847 | 450-846 | |
| Cold work tool steel | Vickers | HV | 80-900 | 80-905 | 104-924 | 82-1009 | * | 98-942 |
| | Rockwell | HRC | 21-67 | 21-67 | 22-68 | 23-70 | | 20-67 |
| Stainless steel | Vickers | HV | 85-802 | * | 119-934 | 88-668 | * | * |
| | Brinell | HB | 85-655 | | 105-656 | 87-661 | | |
| | Rockwell | HRB | 46-102 | | 70-104 | 49-102 | | |
| | | HRC | 20-62 | | 21-64 | 20-64 | | |
| Cast iron lamellar graphite GG | Brinell | HB | 90-664 | * | * | * | 92-326 | * |
| | Vickers | HV | 90-698 | | | | | |
| | Rockwell | HRC | 21-59 | | | | | |
| Cast iron, nodular graphite GGG | Brinell | HB | 95-686 | * | * | * | 127-364 | * |
| | Vickers | HV | 96-724 | | | | | |
| | Rockwell | HRC | 21-60 | | | | 19-37 | |
| Cast aluminium alloys | Brinell | HB | 19-164 | 20-187 | 20-184 | 23-176 | 19-168 | 21-167 |
| | Vickers | HV | 22-193 | 21-191 | 22-196 | 22-198 | | |
| | Rockwell | HRB | 24-85 | | | | 24-86 | 23-85 |
| Copper/zinc alloys (brass) | Brinell | HB | 40-173 | * | * | * | * | * |
| | Rockwell | HRB | 14-95 | | | | | |
| CuAl/CuSn-alloys (bronze) | Brinell | HB | 60-290 | * | * | * | * | * |
| Wrought copper alloys, low alloyed | Brinell | HB | 45-315 | * | * | * | * | * |

*Custom conversion curve / correlation

Table 2: Overview of Available Conversions

3.3.2 Equotip Portable Rockwell

3.3.2.1 Test Principle

During measurement with Equotip 550 Portable Rockwell probe, a diamond indenter is forced into the test piece, and then released back out of the material. The indentation depth is measured continuously during this process. Indentation depth is calculated after decreasing the total load to preload.

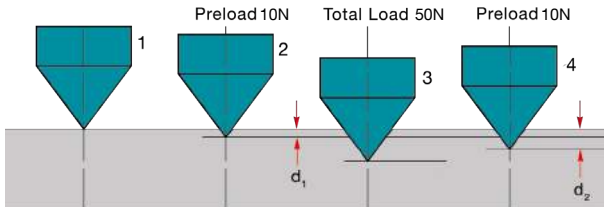


Figure 15: Portable Rockwell Test Principle

3.3.2.2 Sample Preparations

Ensure that the surface of the work piece is clean, smooth and dry. If required, use appropriate cleaning agents for cleaning, such as acetone or isopropanol. Do not use water or any other detergent fluids.

3.3.2.3 Measurement on Basis of DIN 50157

Both depth measurements d_1 and d_2 are taken at preload, first during application (d_1) then after release of the total load (d_2). The difference between d_1 and d_2 originates from the deformation response of the material to penetration.



NOTE! By calculating the penetration depth between the preload and total load, surface roughness discrepancies are significantly disregarded.



NOTE! The hardness testing principle in Portable Rockwell follows the Rockwell stationary test. As for the Rockwell test, no adjustment for the test direction is required. However, there are three main differences to traditional stationary Rockwell tests:

- The test loads are lower.
- The Portable Rockwell indenter is sharper.
- The dwell times during the test are shorter.



NOTE! “MM” stands for “mobile mechanical” measurement, an ancillary that is required by the German standard DIN 50157 to explicitly denote the lower applied loads, sharper indenter shape and shorter loading times during a measurement. The different denomination is formal, i.e. the HMMRC results should be very close if not equal to stationary HRC readings.

3.3.2.4 Test Conditions

To ensure proper hardness readings, the following conditions must be fulfilled. If one or more conditions are not met, the result may be significantly false.

| Probe setup | 50 N probe with clamp | 50 N probe with round standard foot ($\phi = 42 \text{ mm}$) | 50 N probe with tripod | 50 N probe with special feet |
|------------------------------|---|--|----------------------------------|--|
| Minimum test piece thickness | 1 mm at ~20 HB 130 μm at ~70 HRC | | | |
| Maximum test piece thickness | 40 mm | N/A | | |
| Test piece surface condition | recommended mean surface roughness $R_a < 2 \mu\text{m}$ to minimize data scatter | | | |
| Surface curvature | | foot to be used for plane surfaces | very small curvatures acceptable | 18 – 70 mm radius of curvature or 70 mm – ∞ |
| Maximum test piece hardness | 70 HRC | | | |
| Minimum spacing | three times the diameter of a test indentation | | | |

Table 3: Portable Rockwell Test Piece Requirements

3.3.2.5 Installing the Measuring Clamp

The clamp is designed to facilitate the hardness testing of very thin or small samples.

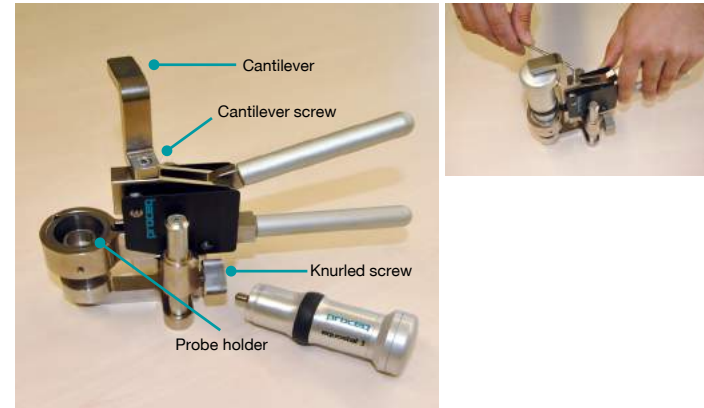


Figure 16: Portable Rockwell Clamp

- Use the 3 mm Allen key setup tool to release the cantilever. Turn it by 90°.
- Take the probe and remove the foot. The diamond indenter remains mounted.
- Screw the probe into the probe holder of the clamp clockwise (hand-tight).
- Turn the cantilever so its tip is centred over the probe; tighten the cantilever screw securely using the 3 mm Allen key setup tool.
- The recommended clearance between the bottom of the probe holder and the sample surface should be between 2 and 5 mm. Adjust the height with the two knurled screws.



NOTE! In case the probe connector is in an inconvenient position, release the set screw. Ensure that the springs in the mechanism do not get lost. Turn the mechanism into a convenient position, aligning the set screw with the guide channel. Lock the set screw so that the probe holder will still slide up and down without rubbing on the set screw.

3.3.2.6 Considerations

- When measuring cylindrical samples with adapters Z4 or Z4+28, make sure, the sample is not twisted on the clamp support. This is best ensured when the back part of the clamp rests on a table and only the sample support of the clamp sticks out over the table's edge.
- When applying the load, slowly squeeze the leavers and allow the sample to adjust to the support. During the measurement, do not touch the sample, if possible. When releasing, grab the sample again.
- Whenever the sample geometry (i.e. the wall thickness) allows it, free-hand measurements usually offer better measuring performance. This applies particularly to measurements on cylinders.
- For small diameter rods (or stiff enough pipes), the V-notch clamp adapter Z2 has been designed. When installing the Z2 support ensure that the centre of the V-notch is centred underneath the probe holder.

3.3.2.7 Installation of Standard Foot or Tripod

The round standard foot permits measurements on test objects that are only accessible from one side, such as large metal sheets. The tripod is used when the flat foot cannot be placed on the test piece without wiggling.

1. The diamond indenter remains mounted.
2. Install the foot on the probe.



Figure 17: Portable Rockwell with Tripod

3.3.2.8 Installing the Special Foot

Two special feet extend the Portable Rockwell application range to cylindrical test pieces.

1. The diamond indenter remains mounted.
2. Install the foot on the probe.
3. Place the foot on the test piece and release the set screw on the foot. Then press down the probe onto the test piece and lock the set screw.



Figure 18: Portable Rockwell Special Feet

3.3.2.9 Conversion Standard

Measurements in HV and HRC are direct correlations therefore no conversion is required. The user has the option of either ASTM E140 or ISO 18265 for conversion to any other scales.

3.3.2.10 Material Groups

Since Portable Rockwell is based on static indentation principle, the hardness conversions are less dependent on material specific properties for the majority of times.

The user still has the possibility to apply customer conversion curves if required, see chapter "6.4 Conversion Curve Creation".

3.3.3 Equotip Ultrasonic Contact Impedance (UCI)

3.3.3.1 Test Principle

The UCI method uses the same pyramid-shaped diamond as a conventional Vickers hardness tester. Unlike Vickers testing, no optical evaluation of the indentation is required, enabling fast and portable measurements. The UCI method excites a rod into an ultrasonic oscillation. The test load is applied by a spring and typically ranges from 1 to 10 kg of force (HV1 – HV10). As the diamond is forced into the material, the frequency of the rod oscillation changes in response to the contact area between the diamond and the material under test. The instrument detects the shift in frequency, converts it to a hardness value which is immediately displayed on the screen.

3.3.3.2 Sample Preparations

Ensure that the surface of the work piece is clean, smooth and dry. If required, use appropriate cleaning agents for cleaning, such as acetone or isopropanol. Do not use water or any other detergent fluids.

3.3.3.3 Standards for UCI measurements

There are two standards which describe the UCI measurements, resp. the instrument:

| | |
|------------|---|
| DIN 50159 | Hardness testing with the UCI method |
| ASTM A1038 | Standard test method for portable hardness testing by the Ultrasonic Contact Impedance method |

For conversions from one hardness unit to another, the user can chose between the following standards:

| | |
|-----------|---|
| ASTM E140 | Standard hardness conversion tables for metals relationship among Brinell, Vickers, Rockwell, Superficial, Knoop, Scleroscope and Leeb hardness |
| ISO 18265 | Conversion of hardness values |

3.3.3.4 Test Conditions

To ensure proper hardness readings, the following conditions must be fulfilled. If one or more conditions are not met, the result may be misleading.

| Probe setup | | HV1 (~9.8 N) | HV5 (~49 N) | HV10 (~98N) |
|---|----------------------|--|---|---|
| Minimal required thickness | | | 5 mm / 0.2 inch | |
| Minimal required weight | | | 0.3 kg / 0.66 lbs | |
| Required surface roughness | Grade class | N8 | N10 | |
| | Maximum roughness | 15 μm / 600 μinch | 60 μm / 2400 μinch | |
| | Average roughness | 3.2 μm / 125 μinch | 12.5 μm / 500 μinch | |
| Acceptable surface curvature | | | Radius > 3 mm | |
| Minimum space | Indentation to edge | | 5 mm / 0.2 inch | |
| | Between indentations | | 3 mm / 0.12 inch | |
| Indentation size on test surface | | | | |
| 300 HV, ~ 30 HRC | Depth | 11.3 μm / 445 μinch | 25.3 μm / 996 μinch | 35.5 μm / 1398 μinch |
| | Diagonal | 79.1 μm / 3114 μinch | 177.1 μm / 6972 μinch | 248 μm / 9764 μinch |
| 600 HV, ~ 55 HRC | Depth | 8 μm / 315 μinch | 17.9 μm / 705 μinch | 25.1 μm / 988.2 μinch |
| | Diagonal | 56 μm / 2205 μinch | 125.3 μm / 4933 μinch | 175 μm / 6890 μinch |
| 800 HV, ~ 63 HRC | Depth | 6.9 μm / 272 μinch | 15.5 μm / 610 μinch | 21.7 μm / 854 μinch |
| | Diagonal | 48.3 μm / 1900 μinch | 108.5 μm / 4272 μinch | 152 μm / 5984 μinch |

Table 4: UCI Test Piece Requirements

3.3.3.5 Installation of the Special Foot



The default foot allows the measurement to be performed on every surface. The probe must be perpendicular to the surface ($\pm 5^\circ$). The special foot can be used to increase the repeatability and avoid the distortion of the results, see chapter “14. Ordering Information”.

1. Unscrew the standard foot and remove it
2. Screw the special foot to the probe tightly



NOTE! To measure in places with limited accessibility, the probe can be used without any foot. If doing so, the side of the rod of the probe must not touch any surface or be handled, as this leads to biased readings.

3.3.3.6 Conversions into Other Units

The frequency shift measured by the UCI probe is not only influenced by the hardness, but also by its elastic properties. The default conversion curve from the frequency shift to Vickers is valid for low-alloyed steel with an e-modulus of 210 ± 10 GPa. As soon as a material has to be tested with a different e-modulus, this existing conversion curve must be adapted. The best way to do so is to calibrate the instrument on the material to be tested. The Equotip 550 offers for this a fast and easy way. Once the hardness value is converted to Vickers, it can be further converted to any other available hardness unit according to either the ASTM E140 or the ISO 18265. Another option is to adjust the default conversion based on the measurement of Portable Rockwell or Leeb. To do so, see chapter “6.5 Combined Method”.

3.4 Instrument Verification / Daily Performance Check

See chapter “6.2 Device Verification” and follow the on-screen procedure. After the verification process your instrument is fully operational and you can now continue with your measurements.



NOTE! The performance check should be done regularly before using the instrument to verify the mechanical and electronic functions of the probe and the indicating device. This requirement is also included in the relevant hardness standards, see chapter “13. Standards & Guidelines”.

3.5 Use of barcode scanners

Instead of entering filenames or comments manually, there is also the possibility to scan in barcodes and use their content to enrich data files.

Simply connect any barcode scanner with HMI interface to the USB-Host connector.

For configuration of the scanner please refer to the manufacturers user guide.

4. Settings

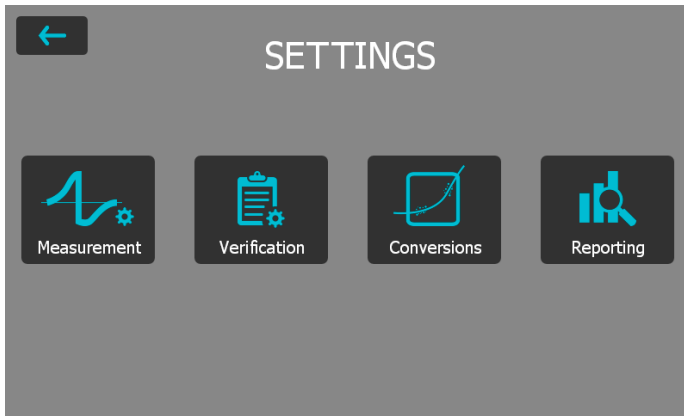


Figure 19: Settings Menu

4.1 Measurements

Access all measurement settings here. The same settings menu can also be accessed from the measurement screen over the icon in the lower right corner.

4.1.1 Probe Type

Probe types are automatically recognised by the device. Settings can be set and will be used for each measurement device separately. If the measurement settings are accessed from the measurement screen, the settings of the active probe can be adjusted.

4.1.2 Measurement Parameters

Material

The desired material group can be selected from the default list, in addition

you may predefine custom material groups which will be displayed here. For custom material/curves please refer to chapter “6.4 Conversion Curve Creation”. For more information on material groups related to Leeb please refer to chapter “3.3.1.9 Material Groups”, for Portable Rockwell chapter “3.3.2.10 Material Groups” and for UCI “3.3.3.6 Conversions into Other Units”.

Primary and Secondary scales

The user has the possibility to select two different scales in which the measurement results are displayed.



NOTE! Conversion for HLD to HV, HB and HRC are standardized as per ASTM E140. Conversion for Portable Rockwell (μm) and UCI can be switched between ASTM E140 and ISO 18265).

Conversion Standards – Leeb

The conversion standard for Shore hardness HS switched between the default conversion according to ASTM E448 or the Japanese conversion according to JIS B7731.



NOTE! Measurements for certain types of Steel can be converted to tensile strength according to ISO 18265.

Conversion Standards – Portable Rockwell

The default measuring method DIN 50157, is applicable for testing all metallic material, and it generally yields more consistency. For conversions, user has the choice to select either ISO or ASTM.

Conversion Standards – UCI

The default measuring method is according to ASTM A1038 and DIN 50159. For conversions, the user has the choice to select either ISO 18265 or ASTM E140.

Impact direction (Leeb only)

With exception to DL and U devices all Leeb impact devices have automatic direction compensation. You may override this and set the impact direction manually. For more information on impact direction please refer to chapter “3.1.1 Leeb Testing Procedure (except Leeb U)”. Impact direction is not relevant to the Portable Rockwell and the UCI devices.

Trigger Load (UCI only)

For the Equotip UCI probe HV1-HV10 the load where the measurement will be triggered can be chosen in the range from HV1 to HV10 (~9.8 – 98 N). If the trigger load is changed during an open measurement series, a new measurement series will be opened.

Units (Portable Rockwell only)

For Portable Rockwell probe, choose to display the indentation depth in metric or imperial units.

4.1.3 Sample IDs

After Measurement

Use this setting to define if the current sample ID’s should be kept for the next measurement series or deleted.

Edit Entries

The entries of the different sample ID fields can be deleted or edited here. For easy increasing or decreasing, use the up- and down- arrows. For adding or removing entry fields, please see chapter “8.1.2 General Features”.

4.1.4 Workflow

Activate User Guidance

Select to display on screen instructions and messages when taking a measurement.

Use Advanced Algorithm (Portable Rockwell only)

Advanced Algorithm provides faster measurements. This is especially useful when testing softer material.

Auto Close Series

Automatically end a series after a set number of measurements. The user can set the series from 1 to 1000 measurements.

Measurement Comment Handling

Use this setting to allow or disallow the user to enter a comment at the completion of a measurement series. When set to “free” this enables the user inputting a comment.

Measurement Series Filename

Enter the file name for the measurement series will be stored. This possibility is disabled, if filename management is activated. See chapter 3.5 on how to use barcode scanners

Save to Folder

Set the folder location where the measurement series file to be stored. This option is disabled, if folder management is activated.

Store Signal Data (Leeb only)

Select to store the raw waveform for Leeb measurements. For Portable Rockwell the signal form will be stored for each measurement automatically, for UCI this option is not available..



NOTE! Storing signal data will cause measurement files to take up more memory.

Enable Warnings

Choose to enable warning display signals and sounds to indicate false measurements.

Use report templates

Here a template for the report can be selected. By default, the default template will be used. This default template can be selected in the template manager.

Operator

Here the test operator can be edited. This operator name is stored for the following measurements, but not for the verifications.

4.1.5 Limits

Enable Upper and Lower Limits

Select to enable the display of the upper and lower tolerance limits for the measurements. Specific color coding is adopted to differentiate between upper and lower limits.

4.2 Verification (Performance & Uncertainty Check)

To see how a verification can be performed please refer to chapter “6.2 Device Verification”.

4.2.1 Test Block Management

It is important to verify the correct functionality of the instrument on a test block calibrated in the genuine native scale of the probe being used. In the test block management section, different test blocks information can be stored. Test blocks that are listed here can then be used during the verification process.

4.2.2 Workflow

Standard

Select the standard according to which the verification should be performed. It can be selected between ISO, ASTM, DIN or a customer defined standard, depending on the probe type.

Minimum series count

The minimum required number of measurements can be selected here. If a standard was selected before, this setting is fixed.

Maximum series count

The maximum allowed number of measurements can be selected here. If a standard was selected before, this setting is fixed.

Operator reference

Here the reference operator name can be entered if required. This name will be used for the verification processes. If no name is entered here, the user can still enter it during the verification process.



NOTE! The performance check should be done regularly before each use of the instrument to verify the mechanical and electronic functions of the probe and the indicating device. This requirement is also included in the different standards, see chapter “8.1 Features”.

4.2.3 Verification Standards and Extended Uncertainty

It is recommended for the instrument to be verified prior to testing. This gives the user the extra assurance that the device is working correctly and the measurement data are accurate. Although the verification process is similar on all Leeb, Portable Rockwell (mechanical penetration depth) and UCI standards, the user has the option to comply with the preferred standard/verification procedure.

- DIN 50156** Leeb hardness testing of metallic materials. Was replaced by ISO 16859.
- DIN 50157** Hardness testing of metallic materials with portable measuring instruments operating with mechanical penetration depth.
- DIN 50159** Hardness testing with the UCI method.

| | |
|--|--|
| ASTM A956 | Standard test method for Leeb hardness testing of steel products. |
| ASTM A1038 | Standard test method for portable hardness testing by the Ultrasonic Contact Impedance method |
| ISO 16859 | Hardness testing of metallic materials by Leeb. |
| Extended Uncertainty (Combined Uncertainty) | Measurement uncertainty analysis is applied to understand the differences in test results and to determine sources of error. The uncertainty of an Equotip Leeb, Equotip Portable Rockwell or Equotip UCI hardness testing system consists of a statistical component, a component inherent to the measurement device and a component arising from the metrological chain between national standard and the user device (traceability). Although uncertainty could be a complicated topic, Equotip 550 automatically calculates the combined uncertainty of the system. All the required information is already available in the calibration certificates provided by Proceq. Therefore the device only requires adding these values in the specified fields and following the simple steps on the display in order to complete the process. |

4.3 Conversions (Hardness Conversions)

There is no direct correlation between any two hardness scales. Therefore conversions must be determined by comparison testing for any given alloy.

4.3.1 Standard Conversions

Proceq has developed correlations to convert the Leeb hardness measurements to other commonly used hardness scales based on groups of alloys that have a close relationship. The conversions for HLD and Material Group 1 (Carbon Steels) are standardized according to ASTM E140-12b.

4.3.2 Custom Conversion Curves

See chapter “6.4 Conversion Curve Creation”.

4.3.2.1 Custom Compensation

In some cases a user must measure hardness on many samples with identical size and shape that is below the ideal limits for accuracy. Studies have been published by ASME and Nordtest that have identified and confirmed the validity of the strategy to apply a compensation factor to correct for the inaccuracies induced by the non-ideal geometry. The methods outlined in chapters “6.4 Conversion Curve Creation” can be applied to create this compensation factor to be applied automatically to the Equotip test result.

4.4 Reporting

The content of the measurement reports can be adjusted here.

4.4.1 Images Explorer

Images, i.e. company logos can be loaded from an USB stick on the device, for use in reports. Pictures must be in the *.png or *.jpg format, ideally come with 72dpi and a maximum resolution of 496x652 pixel.

Upload Images from an USB-stick

To do so follow the steps below.

- Create the folder “PQ-Import” in the main directory of the USB-stick (not as a subfolder in another folder) and fill it with all the picture-files to be uploaded to the Equotip Touchscreen
- Connect the USB-stick to the USB Device plug on the left side of the Equotip Touchscreen
- Click on  and confirm with click on 
- The uploaded images appear in the Images Explorer

 


NOTE! The USB stick must be either formatted in FAT or FAT32. NTFS is not supported.

4.4.2 Report template explorer

The report templates can be managed here. Either the default template can be used, or a fully customized template can be created and edited. Templates can also be copied or exported to an USB stick.

4.4.3 Reporting via PDF

It's possible to create reports directly on the instrument as PDF and store them on USB stick. Choose the measurement files in the data explorer of which a report should be created, mark them by ticking the box. Tap the  button to create the reports. The report will be created with the selected report template. Repeat this for each file. A separate PDF will be created for each measurement series.



NOTE! The report option is only visible if an USB stick is connected to the instrument. The USB stick must be either formatted in FAT or FAT32. NTFS is not supported.

Optionally, also the project file can be exported to the USB stick. Here all measurement series will be included in one file.

4.4.4 Reporting via Equotip Link

Alternatively to create reports the PC-Software Equotip Link can be used. For more details please refer to chapter "11. Equotip Link Software".


5. Data (Explorer)



Figure 20: Data Explorer Menu

5.1 Measurements

5.1.1 Storing Measurements

If the auto close option is disabled or chosen number of impacts is not reached, the series can be closed and saved manually by tapping the store button .

If the auto close option is enabled, the measurement series will be automatically stored as soon as the chosen number of impacts is reached.

The name under which the series will be stored can be edited in the upper left corner.



NOTE! If the file name already exists, the name will be extended by a number and increased with every additional file.

The stored measurements can be organized in folders, by tapping the Data Explorer button on the new folder option

Enter the name of the new folder and confirm by tapping on the back button in the upper left corner.

The folder in which new measurements are stored can be selected under Settings → Measurement → Save to Folder.

5.1.2 Data Explorer

From the main menu select Data → Measurements to review and manage saved measurements data.

Each folder and measurement series is shown as one line in the explorer view.

For each series the probe used, mean value of the series, series name, date & time of the measurement can be seen.

The list can be sorted by tapping on the corresponding header. The small arrow indicates which list is sorted.

Tap on a saved file to open it and return to the Data Explorer list by pressing the back button.

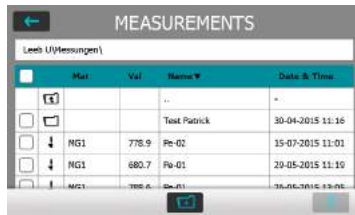


Figure 21: Measurement View in Data Explorer

5.1.3 Review of Data

In the detailed view of a measurement series, all information can be seen and the settings are editable.

All the different views can be switched according to the users needs.

For more details about the different views, please refer to chapter “3.2.2 Measurement Views”.



5.1.4 Delete Files

From stored measurement files, single impacts can be eliminated afterwards. To do so, open the measurement series, tap the value to eliminate and tap delete button

Whole measurement files can be deleted in the Data Explorer. To do so, tap on the box of the appropriate files to select and all selected files can be deleted by tapping the delete button

To erase all data stored on the instrument, in the root folder tap on the box on the left end of the header row then tap the delete button



5.1.5 Copy Files

To copy measurement series, select the file and click on the  icon. Go to the folder where the copy should be created and tap the  icon to paste the file. When copying a file all attributes will be duplicated



NOTE! The file cannot be added in the same folder!

5.1.6 Cut & Paste Files

To move existing measurement series from one place to another, set the tick of the corresponding file and tap on the  icon. Go to the folder where the file should be moved in and tap the  icon to paste the file

5.2 Verifications

From the main menu select “Data”, and then “Verifications” to review and manage saved verification data “6.2 Device Verification”.

The verification data is stored and managed in the same manner as the measurement data. Except no deletion is allowed.

Each folder and measurement series is shown as one line in the explorer view.

Additionally the result for each verification data series, either a “passed” or a “failed” is displayed.

5.3 Mappings

Review finished mapping files here. Incomplete files will not be shown, but must be accessed from the mapping wizard.

6. Wizards

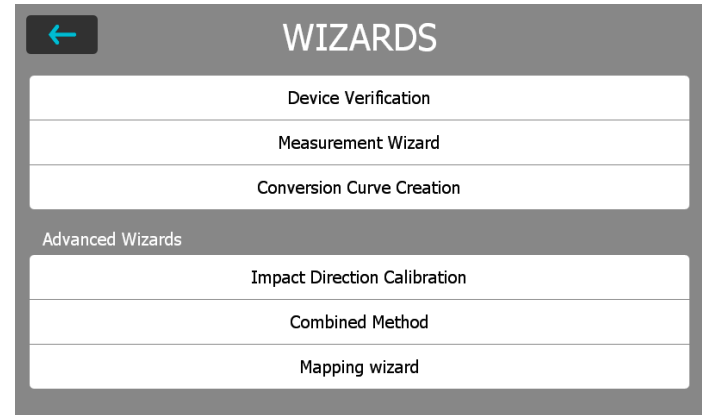


Figure 22: Wizards Menu

Wizards are a unique feature of Equotip 550. These simple step-by-step instructions are for the majority of users, no matter how experienced they are. Interactive wizards help speed up the workflow and improve the measurement’s reliability.

All settings concerning wizards can be edited in the System → User Settings. Also see chapter “8.1 Features”.



NOTE! For Equotip Leeb Impact Device U only the “Device Verification” wizard is available.

6.1 Measurement Wizard

This particular wizard helps define the best measurement principle e.g. impact device to fit the application, simply based on sample geometries and surface conditions. To start, some basic information must be provided to define the test piece. When information is evaluated by the device a series of recommendations are displayed in order of their relevance to the application in question.

After the initial process is complete, the device recommends the appropriate probe, scope of application and preparation information. Settings will then be adopted and the intelligent measurement process begins.



NOTE! Please verify that correct series number, impact direction, material group, scales and limits are defined as well as file and folder name.

6.2 Device Verification

During the verification process, the user will be guided through the entire procedure. At the end of the procedure the instrument is considered verified and the data is stored in the device memory. Verification data is also stored as the verification is performed, therefore any discrepancies occurring over time will be noticeable.



NOTE! This wizard can also be started from the menu System → Probes.



NOTE! A Proceq reference test block is required to complete this wizard successfully.

6.3 Impact Direction Calibration (Leeb only)

Each Leeb impact device requires a calibration in order to automatically compensate for impact direction. This is easily achieved using this wizard.



NOTE! All impact devices are already factory calibrated when shipped, however based on the usage and application it is recommended to recalibrate the impact direction prior to verification process chapter “6.2 Device Verification”. If this process is not completed currently inaccurate data may be obtained.



NOTE! This wizard can also be started from the menu System → Probes.

6.4 Conversion Curve Creation

When default conversions are not suitable for the material being tested, it is recommended to create a customized conversion/correlation. This wizard guides the user through the complete process in a simple manner and provides all the necessary information on comparative measurements.

This creates a brand new conversion curve which is used for any future measurements on the material in question.

6.4.1 Minimizing Conversion Errors

Conversion errors will not normally exceed ± 2 HR for Rockwell scales and ± 10 % for Brinell and Vickers provided the material group is selected correctly. In most cases, the conversion error is significantly lower. If higher accuracy is required or if the alloy under test is not covered by one of the standard conversions, the Equotip 550 provides a variety of methods to define material-specific conversions.

6.4.2 Methods for Setting Up Custom Conversions

The Equotip 550 provides three techniques to accomplish custom conversions, each can be used for all of the three different measuring principles (example HLD → HRC):

One-point method: The Leeb hardness HLD and the hardness in the desired scale (i.e. HRC) are determined for a reference work piece. A standard conversion function HLD-HRC is then adapted through vertical offset until the measured reference data pair lies on the shifted curve.

Two-point method: Two reference samples are tested, one as soft and one as hard as possible to find two data pairs (i.e. HLD / HRC). A standard conversion function HLD-HRC is then adapted through adding a straight line until both of the measured reference data pairs lie on the tilted curve.

Conversion polynomial: If a custom conversion needs to be applied throughout a wide hardness range, several reference samples shall be tested to find a stable basis for interpolation. Up to 5th order polynomials can be programmed into the Equotip 550 indicating device by defining the polynomial coefficients A_i in

$$HRC(HLD) = A_0 + A_1 \cdot HLD + A_2 \cdot HLD^2 + A_3 \cdot HLD^3 + A_4 \cdot HLD^4 + A_5 \cdot HLD^5$$

see Equotip Technical Guide under Information → Documents or in the download section of the Proceq website.



NOTE! When using a polynomial conversion of a higher order, please make sure to have the coefficients with sufficient digits to avoid inaccuracies in calculations.

6.4.3 Example of a Custom Conversion (Two-Point Method)

The data pairs (640 HLD / 41.5 HRC) and (770 HLD / 54.5 HRC) were measured on two reference samples made from “Special Steel”.

To measure “Special Steel” in the future using an adapted HLD-HRC conversion, the original HLD-HRC conversion curve for “1 Steel and cast steel” is tilted and shifted using the two data points. In this example, the custom conversion is defined as valid for the range 41 to 55 HRC.

Once this curve has been created, it can be selected via material group “Customer defined” – “Special Steel”, using the hardness scale “HRC Rockwell C” also see chapter “3.3.1.8 Testing Thin Samples”.



Figure 23: Two-Point Conversion

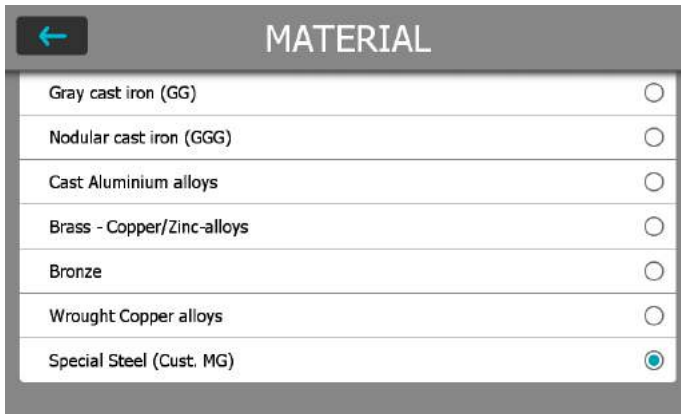


Figure 24: Custom Conversion Menu

6.4.4 Measuring Reference Samples

Sample surfaces must be prepared very carefully and if possible, samples shall meet the specific geometries to avoid coupling method.

The functioning of the Equotip 550 shall be verified against the Leeb test block prior to each measurement series.

The functioning of the static hardness testing machine (HMMRC, HV, HB, HRC etc.) shall be verified against respective test blocks of the corresponding measuring scale and range.

To obtain a pair of comparative values, the mean value from at least 10 HL measurements and at least 3 values from the static test shall be calculated. These values shall be obtained from proximate positions in a small measuring area depending on application.

6.5 Combined Method

The existing default hardness conversions in Equotip Leeb devices are based on specific sample geometries. A Portable Rockwell probe has almost no restriction with regard to thickness and mass. For samples that don't meet the Leeb specification, a simple custom correlation based on the Portable Rockwell measurements enables the user to apply a correction factor and create a new hardness conversion. This is one example where the combined method is used to fit one measuring method with the help of another one, for an application which is not covered by the default setup. But there are several other occasions where this helpful tool offers great help. This can be achieved following the combined method wizard on the Equotip 550. This wizard allows the combination of the Leeb and Portable Rockwell, the UCI and Portable Rockwell and also the combination of UCI with Leeb method. In each combination the later mentioned method is the reference method.

This wizard guides the user in five simple steps through the whole process, and finally creates the conversion curve. For other applications it can be used accordingly. For more information please see the "Equotip Application Guide" on the Proceq homepage.

6.6 Mapping Wizard

The mapping wizard allows the user to create a 2-dimensional map with readings. This is used to 'scan' a whole area. This wizard guides the user through the whole process from defining the area, through the measurements up to the final measuring report. Map size up to 700 x 700 is supported.

6.6.1 Mapping Explorer

Manage and continue incomplete mapping files here, or review finished mappings. Mapping files can also be deleted in this view.

NOTE: It is currently not possible to create reports from mapping files.

6.6.2 Create new Mapping

By tapping the '+' button in the mapping explorer, the actual mapping wizard will be started.

On the first screen, the name has to be selected. The probe type is automatically recognized.

Next, the dimensions of the mapping can be specified by entering the number of measurements for the column and for the row. The maximum is 500 measurements. The name of the two axis can also be edited here.

On the following screen, the starting point can be selected in the before defined mapping.

As a last setting, the three different color ranges have to be specified.

Now you can start measuring with mapping.

NOTE: Each data point in the mapping consists of one measurement series and thus, can contain several readings. The average will be used for the map.

7. Information

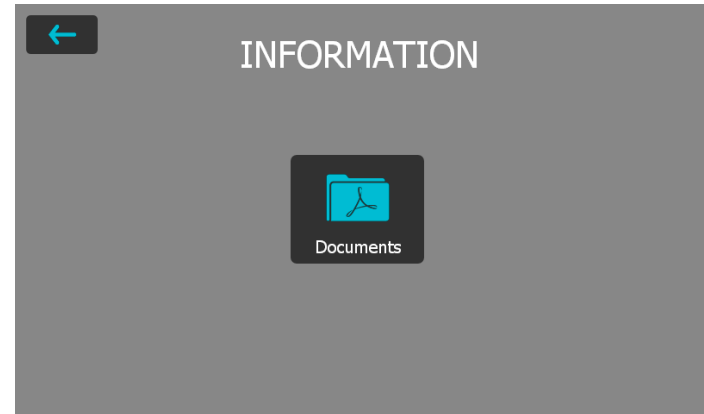


Figure 25: Information Menu

7.1 Documents

All documentation files are stored in this section of the instrument and can be viewed directly when required.

- **Quick Start Guide:** Gives an overview on the instrument including scope of delivery.
- **Operating Instructions:** This document.
- **Certificates:** Certificates applicable to this product.
- **Application Booklet:** In-depth technical information on the different measurement principles, its standards, influence of elevated temperatures, heavy use instructions and more.

- **Platform Remote Control Package:** Instructions are given on how the instrument can be used with the remote control, i.e. for automation etc.
- **More documents** may be added at a later date.



NOTE! The last viewed document can be quickly accessed by pressing the “Soft Key”. For more information see chapter “2.1 Installation”.

7.2 Upload PDF-Files from an USB-stick

Additional documents in the PDF format can be stored on the instrument. To do so follow the steps below.

- Create the folder “PQ-Import” in the main directory of the USB-stick (not as a subfolder in another folder) and fill it with all the pdf-files to be uploaded to the Equotip Touchscreen
- Go to Information/Documents
- Connect the USB-stick to the USB Device plug on the left side of the Equotip Touchscreen
- Click on and confirm with click on
- The uploaded PDF-files appear on the bottom of the document list



NOTE! The USB stick must be either formatted in FAT or FAT32. NTFS is not supported.

8. System

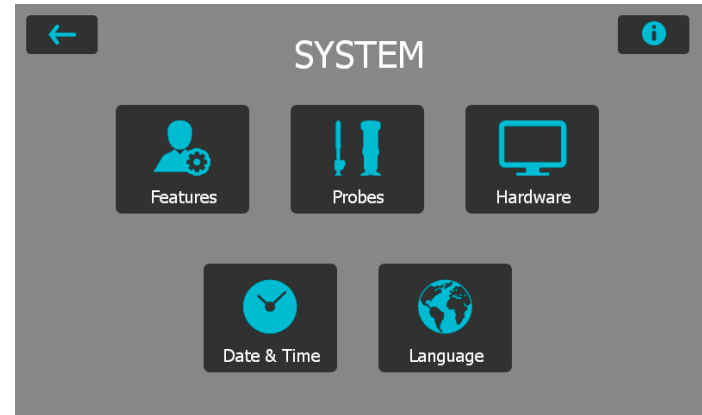


Figure 26: System Menu

8.1 Features

8.1.1 Device Lock Settings

Lock/Unlock: Select this to lock the instrument and protect it from unintentional changes.

Password: A password can be set for the lock/unlock function. If this field is left empty, no password is required to unlock the user settings.

8.1.2 General Features

Measurement Wizard: There are three options available on how the measurements wizards are enforced.

Verification Notification: Verification of the instrument can be set to forced, optional or disabled. When set to disabled the user will not be forced to perform an indirect verification. The setting “optional” is just a reminder. If “forced” or “optional” is selected, an entry appears where the verification interval may be chosen.

Custom Fields: The custom entry fields can be edited here. Beside the five default fields which cannot be deleted, additional 20 fields can be added.

8.1.3 Data Management

Use Folder Manager

Activate this option to use automatic folder management as configured in the Folder Manager.

Folder Manager

Here the desired path can be edited. A maximum of four subfolders can be created with selectable information. As soon as one of this information changes, a new folder will be created automatically.

Use File Manager

Activate this option to use automatic file naming as configured in the File Manager.

File Manager

An automatic name can be configured here consisting of four different information fields.

Long Filename Viewing

Choose here between a full view of the filename, or if only a selected range should be displayed in the measurement screen. This setting influences only the name on the measurement screen, but not in the explorer or reports.

8.1.4 Probe Features

For each probe type there is an option to protect its settings. Furthermore, for each probe type the different features to protect can be selected.



NOTE! To actually lock the device with the selected settings see chapter 8.1.1

Factory reset: Select the options to delete all relevant data from the device.




NOTE! This step cannot be undone, deleted items are permanently destroyed!

8.2 Probes

Information about the connected probe can be viewed here.

Impact Direction Calibration (Leeb only): The angle calibration for this particular probe can be redone. This calibration can be done only for Equotip Leeb Impact Devices.

Verification: Verification measurement series can be started here.

To see information about other used probes, tap on the  button.

Probe Serial Number (Leeb U only): As the serial number can not be recognized automatically, the user has to enter it manually here.

8.3 Hardware

General settings about the user interface and power options can be edited here.

Sound: The volume of the audio notifications of the instrument can be adjusted respectively switched off.

Display: The user can adjust the brightness of the display backlight.

Power: The time after when the instrument dims the display, or shuts

down can be adjusted, for both battery and AC powered operation.

Network: Network settings can be adjusted here.


8.4 Date & Time

Date and time is set in this submenu. The format of these settings and the time zone can also be modified.

8.5 Language

The language setting of the instrument can be selected. Eleven different languages are available. The language of the help file is the same as for the rest of the menu.

8.6 Device information

Tap the info button  in the upper right corner to view all the information related to the device e.g. name, version and serial number can be found in this section as well as battery status.

9. Maintenance and Support

9.1 Maintenance

The instrument should be calibrated annually to ensure consistent, reliable and accurate measurements. However, the service interval may be based on actual experience and usage. Consult the applicable standards for more guidance.

9.1.1 Regular Device Check

Performance checks, see chapter “4.2 Verification (Performance & Uncertainty Check)” of the instrument should be carried out at least once a day or at the latest after 1000 impacts. In the case of infrequent use, carry out the check before the beginning and at the end of a test series. In addition, have the device calibrated by an authorized Proceq Service Center once a year.



NOTE! The unit is working properly when the average is within the target range. Otherwise, please see chapter “10. Troubleshooting”.

9.1.2 Cleaning

Leeb Impact device: Unscrew the support ring. Remove the impact body from the guide tube. Clean the guide tube with the cleaning brush, then reassemble it.

Leeb Indenters: Clean the ball of the Leeb impact bodies with acetone or similar solvent. (Do not use water or water based detergents!)

Portable Rockwell and UCI probes: Clean the probes and the diamond indenters with a clean, dry cloth.

Housing: Clean the display and housing with a clean, dry cloth after use. Also clean the connector sockets with a clean, dry brush.



NOTE! Never immerse the device in water. Do not use compressed air, abrasives, solvents or lubricants to clean the device.

9.1.3 Storage

Only store the Equotip 550 in the original packaging and in a dry room free of dust.

9.1.4 Re-calibration for Impact Direction (Leeb only)

For Leeb impact devices the compensation function relies on parameters specific to each impact device, which are stored in the device. Validity of the active calibration can be checked through System → Probes → Angle Calibration and then pressing the “Test” button. For each impact direction, the deviation from the curve shall be less than ± 0.2 Leeb (HL).

The parameters may change with time or due to external influences. A verification or re-calibration of the automatic compensation function in Equotip Leeb impact devices (except type DL) is recommended particularly when:

- Impact device has not been used for a long time, or
- Impact body has been replaced.

A re-calibration is done by consecutive selection of “0° (vertical down)”, “90° (horizontal)” and “180° (vertical up)”.

9.1.5 Updating the Equotip 550 OS and Application

Connect the device to the computer. Updates can be done using Equotip Link as follows:

- Select update symbol  in Equotip Link
- Select “Express” and confirm with “Next”.

- Select the device type and confirm with “Next”.
- In the “Choose Communication Type” dialog box, select the type of communication used between the Equotip and PC, and then click “Next”.
- In the “Device search result and selection” dialog box, make sure the serial number of the device in the drop-down field is the device to be updated, and then click “Next”.
- PqUpgrade will now search the Proceq servers for any available updates. To do so, a working internet connection is required.
- Follow the on-screen instructions to finish the update.



NOTE! Although saved data is not deleted during the update process, it is recommended to save the stored data in before updating the firmware.



NOTE! The “Custom” update is recommended for advanced users only.

9.2 Support Concept

Proceq is committed to providing a complete support service for this instrument by means of our global service and support facilities. It is recommended that the user register the product on www.proceq.com to obtain the latest on available updates and other valuable information.

9.3 Standard Warranty and Extended Warranty

The standard warranty covers the electronic portion of the instrument for 24 months from the date of purchase. The mechanical portion of the instrument is covered by warranty for 6 months. An extended warranty for an additional one, two or three years for the electronic portion of the instrument may be purchased up to 90 days from the date of purchase.

9.4 Disposal



Disposal of electric appliances together with household waste is not permissible. In observance of European Directives 2002/96/EC, 2006/66/EC and 2012/19/EC on waste, electrical and electronic equipment and its implementation, and in accordance with national and local law, electric tools and batteries that have reached the end of their life must be collected separately and returned to an environmentally compatible recycling facility.

10. Troubleshooting

10.1 Incorrect Measurements / Failed Performance Check

10.1.1 Leeb

If the verification wizard fails, the following actions shall be done:

- Check first that the test block is clean, smooth and dry. See chapter “3.3.1.2 Sample Preparations”. Replace the test block if there is insufficient space for additional tests.
- Clean the impact body, paying close attention to the indenter ball at the bottom and to the catch pin at the top of the body. Replace the impact body if necessary.
- Clean the impact device.
- Check the mounting and wear of the support ring. Check for deposits. Clean or replace if necessary.
- The incorrect material group, hardness scale or a wrong setting for the impact direction may have been selected. Refer to chapter “4. Settings”.
- The selected hardness scale is not in the permissible range (no conversion). Select another scale.
- Check if individual values are scattered very widely or are continuously too low.
- The impact is triggered while the device is not held vertically on the surface. This may occur especially when using impact device DL. Try using the plexiglass sleeve DL for better alignment.
- Sample is insufficiently supported. Prepare the sample for the impact e.g. through use of the coupling method, see chapter “3.3.1.6 Testing Light Samples”.
- If the instrument still shows excessive deviations: return the device to an authorized Proceq Service Centre for recalibration / inspection.



NOTE! Do not resurface test blocks or try to refurbish impact bodies. This will impair accuracy and may also deteriorate functionality of the Equotip 550.



NOTE! Do not resurface test blocks or try to use non-Proceq indenters. This will impair accuracy and may also deteriorate functionality of the Portable Rockwell.

10.1.2 Portable Rockwell

If the verification wizard fails, the following actions shall be done:

- Confirm the foot is seated securely on the probe or the probe securely in the clamp, respectively.
- Clean the indenter, paying close attention especially to the front part (diamond) and to the screw thread.
- Check that the test block is clean, smooth and dry. See chapter “3.3.2.2 Sample Preparations”. Replace the test block if there is insufficient space for additional tests.
- Check the mounting and wear of the stand and clamp. Check for deposits. Clean or replace if necessary.
- An incorrect conversion may have been selected. See chapter “4. Settings”.
- The selected conversion scale is not in the permissible range (“no conversion”). Select another hardness scale
- The test is conducted while the device is not held vertically on the surface, which will generally give a warning on the guidance dialog. This may occur especially when using tripod. Try using another foot, or take more care to align the probe vertically to the surface.
- Test piece is insufficiently supported. Prepare the test piece for the test e.g. through supporting it with a larger metal piece.
- Make sure the probe does not tilt / move on the surface. See chapter “3.3.1.7 Testing Curved Surfaces”.
- If the instrument still shows excessive deviations: return the device to an authorized Proceq Service Centre for recalibration / inspection.

10.1.3 UCI

The allowable tolerances for the UCI performance test differ depending on the selected standard. According to the DIN 50159 it should typically not differ more than 5% from the given value. This tolerance is getting wider for harder test blocks. The Equotip 550 considers these limits according to the standard.

According to the ASTM A1038 the values may not deviate by more than 7% from the given value. This tolerance is getting wider for harder test blocks. The Equotip 550 considers these limits according to the standard.

- Check to have the correct settings selected, i.e. no conversion activated.
- Clean the indenter, paying close attention especially to the front part (diamond).
- Check that the test block is clean, smooth and dry. See chapter “3.3.3.2 Sample Preparations”. Replace the test block if there is insufficient space for additional tests.
- Check the mounting and wear of the special foot. Check for deposits. Clean or replace if necessary.
- If the test was conducted while the device was not held vertically on the surface, the reading can be misleading. This may occur especially when using the standard foot. Try using the special foot, or take more care to align the probe vertically to the surface.

- Test piece is not fulfilling the geometry requirements or is insufficiently supported. Check chapter “3.3.3.4 Test Conditions” for the minimum requirement. Prepare the test piece for the test i.e. by supporting it with a larger metal piece.
- If the instrument still shows excessive deviations: Return the device to an authorized Proceq Service Centre for recalibration / inspection.



NOTE! Do not resurface test blocks.

10.2 No Reading Displayed

- Check the connection of the probe.
- Check if a genuine Equotip impact body (with the engraving “equo”) is inserted in the impact device by unscrewing the support ring.
- Check for tight seating of the support ring on the thread of the impact device.
- Check for tight seating of the support ring on the thread of the impact device. Check whether the impact body is armed and released when conducting the load – trigger procedure. If not, the catch chuck of the impact device may be broken or the impact body is inserted upside-down. Insert the impact body correctly or replace the impact device with a basic Equotip Leeb impact device.

10.3 Battery

If the indicating device does not switch on, recharge the battery using the power supply, see chapter “2.1 Installation”.

The battery can be replaced with another Equotip Lithium-Ion battery.



NOTE! If the operation time of the battery is shortening noticeably, order a new battery. The battery lifetime has expired when the LED does not go off even though the battery has been charged for several days.

Danger: Only use the power supply (12 V, 5 A) to charge the Equotip 550.

10.4 Touchscreen Calibration

When a protective screen foil is used, it can be necessary to re-calibrate the touchscreen of the Equotip 550.

To do so, press and hold the middle hardware button (Fullscreen) for 10s. During the calibration process, don't touch the display unit, as it can bias the calibration.

11. Equotip Link Software

11.1 Starting Equotip Link



Locate the file “Equotip Link Setup.exe” on your computer or on the DVD and click on it. Follow the instructions on the screen. Make sure that the “Launch USB Driver install” tick is selected.




Double click on the Equotip Link Icon on your desktop or start the program via the start menu.


11.2 Application Settings

The menu item “File – Application settings” allows the user to select the language and the date and time format to be used.


11.3 Connecting to an Equotip 550 Touchscreen Unit

Connect the Equotip 550 Touchscreen Unit to an USB port or connect it to the Ethernet (DHCP server required), then select  to download data from the Equotip 550 Touchscreen Unit.

The following window will be displayed: Select the appropriate communication type. If connecting through Ethernet, please enter the instruments IP address in the appropriate field. Click on “Next >”.

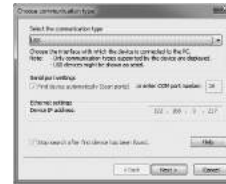


When an Equotip 550 has been found its details will be displayed on the screen. Click on the “Finish” button to establish the connection

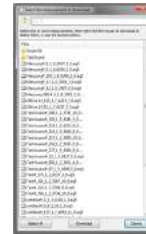

Measurement files and folders stored on the Equotip Touchscreen will be displayed as shown on the left.


Click on the measurement file to be transferred. If multiple files have to be transferred, select them while holding the “shift” or “ctrl” button, or click on “Select All”.

11.4 Connection to Portable Rockwell Probe

- Connect the Portable Rockwell probe to a PC using the provided probe cable.
- Start the Equotip Link software, and click on the Portable Rockwell icon  to detect the Portable Rockwell probe. Click the “New” button at the bottom of the screen.
- Select the hardness scale to be displayed (Hardness scales).
- Select the number of readings “n” per measurement series.

11.4.1 Viewing Data

The transferred measurements from your Equotip 550 will be displayed on the screen:



| Measurement | Verify/Status | Custom Comments | Date & Time | Mean | Total | Std. dev. | Probe | Material | Scale |
|---------------------------|---------------|-----------------|-----------------------|------|-------|-----------|----------------|------------------------|-------|
| unlabeled_121_2_1_402... | | | 12/31/2014 9:56:09 AM | | 11.1 | | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_0804_8_3_7_4... | | | 12/31/2014 9:58 AM | | 1 | 0.0 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| Office 14_113_3_1_421... | | | 12/31/2014 10:00 AM | | 7 | 11.54 | Leak Impres... | 6 Cast Aluminum alloy | HFB |
| Office 17_2_1_221... | | | 12/31/2014 10:02 AM | | 7 | 9.09 | Leak Impres... | 6 Cast Aluminum alloy | HFB |
| unlabeled_16_1_7_421... | | | 01/01/2015 1:02 PM | | 8 | 1.4 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_16_1_3_194... | | | 01/01/2015 1:06 PM | | 7 | 29.3 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_16_1_3_154... | | | 01/04/2015 1:08 PM | | 6 | 5.80 | Portable Ro... | 1 Steel and cast steel | HBC |
| Missing 0804_4_1_1_8... | | | 01/15/2015 1:10 PM | | 2 | 0.37 | Leak Impres... | 7 Brass - Copper/Br... | HFB |
| Missing 152_3_3_238... | | | 01/15/2015 2:04 PM | | 6 | 5.15 | Leak Impres... | 7 Brass - Copper/Br... | HBC |

Click on the double arrow icon in the first column to see more details.


11.5 Adjusting the Settings

“All settings, such as material group, scale, impact direction and both limits can be changed afterwards in Equotip Link.

If the settings of multiple measurement series have to be changed, select each of them while holding the “shift” or “ctrl” button.

11.5.1 Adjusting Date & Time

Right click in the “Date & Time” column.

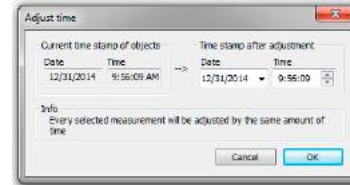

The time will be adjusted for the selected series only.

11.6 Exporting Data

Equotip Link allows you to export selected objects or the entire project. To use the data for further analysis in a third party program, such as e.g. Microsoft Excel, it can be exported as a comma separated file (CSV). To use it directly in a report, the series data can be exported as a graphic. As a third option, selected series data can be printed out directly on a printer.



| Measurement | Verify/Status | Custom Comments | Date & Time | Mean | Total | Std. dev. | Probe | Material | Scale |
|---------------------------|---------------|-----------------|---------------------|------|-------|-----------|----------------|------------------------|-------|
| unlabeled_121_2_1_402... | | | 12/31/2014 9:56 AM | | 11.1 | | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_0804_8_3_7_4... | | | 12/31/2014 10:00 AM | | 1 | 0.0 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| Office 14_113_3_1_421... | | | 12/31/2014 10:02 AM | | 7 | 11.54 | Leak Impres... | 6 Cast Aluminum alloy | HFB |
| Office 17_2_1_221... | | | 12/31/2014 10:02 AM | | 7 | 9.09 | Leak Impres... | 6 Cast Aluminum alloy | HFB |
| unlabeled_16_1_7_421... | | | 01/01/2015 1:02 PM | | 8 | 1.4 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_16_1_3_194... | | | 01/01/2015 1:06 PM | | 7 | 29.3 | Leak Impres... | 6 Cast Aluminum alloy | HLD |
| unlabeled_16_1_3_154... | | | 01/04/2015 1:08 PM | | 6 | 5.80 | Portable Ro... | 1 Steel and cast steel | HBC |
| Missing 0804_4_1_1_8... | | | 01/15/2015 1:10 PM | | 2 | 0.37 | Leak Impres... | 7 Brass - Copper/Br... | HFB |
| Missing 152_3_3_238... | | | 01/15/2015 2:04 PM | | 6 | 5.15 | Leak Impres... | 7 Brass - Copper/Br... | HBC |



Click on the “Export as CSV file(s)” icon. The data is then exported as a Microsoft Office Excel comma separated file. The export options may be chosen in the following window:



Click on the “Export as graphic” icon to open the following window which allows the various export options to be chosen.



Click on the printer icon to directly print a report of the selected measurement series.

11.7 Exporting and Importing of Setting Profiles

To transfer all the selected settings from one instrument to another, or to back up, click on “Equotip – Download device application settings”. The actual settings will be stored in the specified folder on the PC as an archive.

To re-install stored settings, click on “Equotip – Upload device application settings”.

11.8 Exporting and Importing of Conversion Curves

Custom conversion curves created on the instrument can be downloaded to the PC by clicking on “Equotip - Download customer conversion”. All available customer conversions from the instrument will be stored on the PC in the folder ...\Proceq\EquotipLink\Conversions.

To upload a conversion curve from your PC, choose “Equotip - Upload customer conversions”. This is also possible for existing Equotip3 conversion curves.

12. Technical Specifications

12.1 Instrument

| | |
|----------------------------|---|
| Display | 7" color display 800x480 pixels |
| Memory | Internal 8 GB Flash memory (up to 1'000'000 measurements) |
| Regional settings | Metric and Imperial units, multi-language and timezone supported |
| Battery | Lithium Polymer, 3.6 V, 14.0 Ah |
| Battery lifetime | > 8h (in standard operating mode) |
| Power input | 12 V +/-25 % / 1.5 A |
| Weight (of display device) | About 1525 g (incl. Battery) |
| Dimensions | 250 x 162 x 62 mm |
| Max. altitude | 2'500 m above sea level |
| Humidity | < 95 % RH, non condensing |
| Operating temperature | 0 to 30°C (32 to 86°F) (Charging, running instrument) 0 to 40°C (32 to 104°F) (Charging, instrument is off) -10 to 50°C (14 to 122°F) (Non-charging) |
| Environment | Suitable for indoor & outdoor use |
| IP classification | IP 54 |
| Pollution degree | 2 |
| Installation category | 2 |



NOTE! Charging equipment is for indoor use only (no IP classification).

12.2 Power Supply

| | |
|-----------------------|------------------------------|
| Model | HK-AH-120A500-DH |
| Input | 100-240 V / 1.6 A / 50/60 Hz |
| Output | 12 V DC / 5 A |
| Max. altitude | 2500 m above sea level |
| Humidity | < 95% |
| Operating temperature | 0 - 40°C (32 to 104°F) |
| Environment | Indoor use only |
| Pollution degree | 2 |
| Installation category | 2 |

12.3 Equotip Leeb Impact Devices

| | |
|-----------------------|--|
| Measuring range | 1-999 HL |
| Measuring accuracy | ± 4 HL (0.5 % at 800 HL) ± 6 HLU (for Leeb U) |
| Resolution | 1 HL; 1 HV; 1 HB; 0.1 HRA; 0.1 HRB; 0.1 HRC; 0.1 HS; 1 MPa (N/mm ²) |
| Impact direction | Automatic compensation (excl. DL/U probe) |
| Impact energy | <ul style="list-style-type: none">• 11.5 Nmm for D, DC, E, S probes• 11.1 Nmm for DL probe• 3.0 Nmm for C probe• 90.0 Nmm for G probe• 200.0 Nmm for U probe |
| Mass of impact body | <ul style="list-style-type: none">• 5.45 g (0.2 ounces) for D, DC, E, S probes• 7.25 g (0.26 ounces) for DL probe• 3.10 g (0.11 ounces) for C probe• 20.0 g (0.71 ounces) for G probe• 26.0 g (0.92 ounces) for U probe |
| Ball indenter | <ul style="list-style-type: none">• Tungsten carbide, 3.0 mm (0.12") diameter for C, D, DC probes• Tungsten carbide, 2.78 mm (0.11") diameter for DL probe• Tungsten carbide, 5.0 mm (0.2") diameter for G probe• Ceramics, 3.0 mm (0.12") diameter for S probe• Polycrystalline diamond, 3.0 mm (0.12") diameter for E probe• Hardened Steel, 50.0 mm (1.97") diameter for U probe |
| Operating temperature | -10 to 50°C (14 to 122°F) |

12.4 Equotip Portable Rockwell Probe

| | |
|-----------------------|--|
| Dimensions | 112 x ø 40 mm (4.4 x ø 1.57 inches without foot) |
| Weight | 260 g (9.17 oz) |
| Power supply | Via USB (5 V, max. 100 mA) |
| Measuring range | 0-100 µm; 19-70 HRC; 34-1080 HV |
| Measuring accuracy | 1.5 HRC according to DIN 50157 |
| Resolution | 0.1 µm; 0.1 HRC; 1 HV |
| Test direction | Any direction (no correction required) |
| Test loads | 10 N / 50 N (probe 50 N) |
| Diamond indenter | Angle 100.0° ± 0.5° |
| Operating temperature | 0 to 50°C (32 to 122 °F) |
| Humidity | Non-condensing, 90% max. |

12.5 Equotip UCI Probe

| | |
|-----------------------|--|
| Dimensions | 155 x \varnothing 40 mm (6.1 x \varnothing 1.57 inches) without foot |
| Weight | 270 g (9.52 oz) |
| Power Supply | via Proceq Interface |
| Measuring Range | 20 – 2000 HV |
| Measuring accuracy | \pm 2 % (150 – 950 HV) |
| Resolution | 1 HV; 0.1 HRC |
| Test direction | Any direction (no correction required) |
| Trigger loads | Selectable: HV1 (~9.8N), HV5 (~49N), HV10 (~98N) |
| Diamond indenter | Vickers diamond according to ISO 6507-2 |
| Operating temperature | 0 to 50°C (32 to 122°F) |
| Humidity | Non-condensing, 90% max. |

13. Standards & Guidelines

- ISO 16859
- ISO 18265
- DIN 50156 / 50157 / 50159
- ASTM A956 / E140 / A370 / A1038
- DGZfP Guideline MC 1
- VDI / VDE Guideline 2616 Paper 1
- Nordtest Technical Report Series 424, Reports 99.12 / 99.13 / 99.36
- ASME CRTD-91
- GB/T 17394
- JB/T 9378
- JJG 747
- JIS B7731

14. Ordering Information

14.1 Units

| Part No. | Description |
|------------|--|
| 356 10 001 | Equotip 550 consisting of Equotip Touchscreen incl. Battery, Power Supply, USB-Cable, Surface Roughness Comparator Plate, DVD with Software, Documentation, Carrying Strap and Carrying Case |
| 356 10 002 | Equotip 550 Leeb D consisting of Equotip Touchscreen incl. Battery, Equotip Basic Leeb Impact Device D, Impact Body D, Support Rings (D6,D6a), Cleaning Brush, Impact Device Cable, Test Block ~775 HLD / ~56 HRC, Coupling Paste, Power Supply, USB-Cable, Surface Roughness Comparator Plate, DVD with Software, Documentation, Carrying Strap and Carrying Case |
| 356 10 003 | Equotip 550 Leeb G consisting of Equotip Touchscreen incl. Battery, Equotip Basic Leeb Impact Device G, Impact Body G, Support Rings (G6,G6a), Cleaning Brush, Impact Device Cable, Test Block ~570 HLG / ~340 HB, Coupling Paste, Power Supply, USB-Cable, Surface Roughness Comparator Plate, DVD with Software, Documentation, Carrying Strap and Carrying Case |
| 356 10 004 | Equotip 550 Portable Rockwell consisting of Equotip Touchscreen incl. Battery, Equotip Portable Rockwell Probe 50 N, Protective Rubber Sleeve, Probe Cable, Test Block ~62HRC, Power Supply, USB-Cable, Surface Roughness Comparator Plate, DVD with Software, Documentation, Carrying Strap and Carrying Case |

| | |
|------------|--|
| 356 10 006 | Equotip 550 Leeb U (for paper, film and foils) consisting of Equotip Touchscreen incl. Battery, Equotip Leeb Impact Device U, Cleaning Brush, Probe Cable, Power Supply, USB-Cable, DVD with Software, Documentation, Carrying Strap and Carrying Case |
| 356 10 007 | Equotip 550 UCI HV1 - HV10 consisting of Equotip Touchscreen incl. Battery, Equotip UCI Probe HV1 - HV10, UCI Probe Cable, UCI Test Block ~850 HV, Power Supply, USB-Cable, Surface Roughness Comparator Plate, DVD with Software, Documentation, Carrying Strap and Carrying Case |
| 356 10 021 | Equotip 550 Portable Rockwell & Leeb D Kit consisting of Equotip 550 Leeb D (356 10 002) and Equotip Portable Rockwell Probe 50 N (356 00 600) |
| 356 10 023 | Equotip 550 Portable Rockwell & UCI Kit consisting of Equotip 550 UCI HV1-HV10 (356 10 007) and Equotip Portable Rockwell Probe 50 N (356 00 600) |
| 356 10 024 | Equotip 550 Leeb D & UCI Kit consisting of Equotip 550 Leeb D (356 10 002), Equotip UCI Probe HV1-HV10 (356 00 800) and Equotip UCI Test Block ~850 HV, ISO 6507-3 HV5 Calibration (357 54 100) |

14.2 Impact Devices & Probes

| Part No. | Description |
|------------|---|
| | Impact Device incl. Support Ring, Impact Body, Cable |
| 356 00 500 | Equotip Leeb Impact Device C |
| 356 00 100 | Equotip Leeb Impact Device D |

| | |
|------------|---|
| 356 00 110 | Equotip Leeb Impact Device DC |
| 356 00 120 | Equotip Leeb Impact Device DL |
| 356 00 400 | Equotip Leeb Impact Device E |
| 356 00 300 | Equotip Leeb Impact Device G |
| 356 00 200 | Equotip Leeb Impact Device S |
| 360 04 600 | Equotip Leeb Impact Device U |
| | Probe only |
| 353 00 501 | Equotip Basic Leeb Impact Device C |
| 353 00 101 | Equotip Basic Leeb Impact Device D |
| 353 00 111 | Equotip Basic Leeb Impact Device DC |
| 353 00 121 | Equotip Basic Leeb Impact Device DL |
| 353 00 401 | Equotip Basic Leeb Impact Device E |
| 353 00 301 | Equotip Basic Leeb Impact Device G |
| 353 00 201 | Equotip Basic Leeb Impact Device S |
| 360 04 032 | Equotip Basic Leeb Impact Device U |
| 356 00 600 | Equotip Portable Rockwell Probe 50N (for Equotip 550 or PC) |
| 356 00 800 | Equotip UCI Probe HV1-HV10 |

14.3 Parts and Accessories

| Part No. | Description |
|------------|--|
| 327 01 043 | Carrying Strap complete |
| 327 01 033 | Battery complete |
| 351 90 018 | USB-Cable 1.8 m (6 ft) |
| 327 01 061 | Power Supply |
| 711 10 013 | Power Supply Cable USA 0.5 m (1.7 ft) |
| 711 10 014 | Power Supply Cable UK 0.5 m (1.7 ft) |
| 711 10 015 | Power Supply Cable EU 0.5 m (1.7 ft) |
| 327 01 053 | Quick Charger |
| 356 00 081 | Equotip Surface Roughness Plate |
| 350 01 015 | Equotip Coupling Paste |
| 356 00 082 | Display Antiglare Protection Film for Touchscreen Unit |
| 356 00 080 | Equotip Leeb Impact Device Cable 1.5 m (5 ft) |
| 353 00 086 | Equotip Leeb Impact Device Extension Cable 5 m (15 ft) |
| 356 00 083 | Equotip Leeb Impact Device U Cable 1.5 m (5 ft) |
| 350 01 004 | Equotip Impact Body D/DC |
| 350 71 311 | Equotip Impact Body DL |
| 350 71 413 | Equotip Impact Body S |
| 350 08 002 | Equotip Impact Body G |
| 350 07 002 | Equotip Impact Body E |
| 350 05 003 | Equotip Impact Body C |

| | |
|------------|--|
| 360 04 504 | Equotip Impact Body U |
| 350 01 009 | Equotip Support Ring D6 |
| 350 01 010 | Equotip Support Ring D6a |
| 350 08 004 | Equotip Support Ring G6 |
| 350 08 005 | Equotip Support Ring G6a |
| 350 71 314 | Equotip Support Ring DL |
| 360 04 531 | Equotip Support Ring U |
| 353 03 000 | Set of Support Rings (12pcs) for Equotip Leeb Impact Device D/DC/C/E/S |
| 350 01 008 | Equotip Leeb Impact Device Cleaning Brush D/DC/C/E/S |
| 350 08 006 | Equotip Leeb Impact Device Cleaning Brush G |
| 360 04 502 | Equotip Leeb Impact Device Cleaning Brush U |
| 350 01 007 | Equotip Leeb Impact Device DC Loading Stick |
| 350 71 316 | Equotip Leeb Impact Device DL Plexiglas Sleeve |
| 360 04 530 | Assembly Gauge for Equotip Leeb Impact Device U |
| 354 01 139 | Equotip Portable Rockwell Probe Cable 2 m (6 ft) |
| 354 01 200 | Equotip Portable Rockwell Measuring Clamp |
| 354 01 130 | Equotip Portable Rockwell Tripod |
| 354 01 250 | Equotip Portable Rockwell Special Foot RZ 18 - 70 |
| 354 01 253 | Equotip Portable Rockwell Special Foot RZ 70 - ∞ |
| 354 01 137 | Equotip Portable Rockwell Protective Rubber Sleeve |

| | |
|------------|--|
| 354 01 243 | Equotip Portable Rockwell support Z2 for measuring clamp |
| 354 01 229 | Equotip Portable Rockwell Support Z4+28 for measuring clamp (for tubes and pipes over Ø 28 mm) |
| 354 01 228 | Equotip Portable Rockwell support Z4 for measuring clamp (for tubes and pipes up to Ø 28 mm) |
| 356 00 720 | Equotip UCI Special Foot |

| | |
|------------|--|
| 357 12 120 | Equotip Test Block DL, ~780 HLDL / ~325 HB, Proceq Factory Calibration |
| 357 13 120 | Equotip Test Block DL, ~890 HLDL / ~56 HRC, Proceq Factory Calibration |
| 357 13 400 | Equotip Test Block E, ~740 HLE / ~56 HRC, Proceq Factory Calibration |
| 357 14 400 | Equotip Test Block E, ~810 HLE / ~63 HRC, Proceq Factory Calibration |
| 357 31 300 | Equotip Test Block G, <450 HLG / <200 HB, Proceq Factory Calibration |
| 357 32 300 | Equotip Test Block G, ~570 HLG / ~340 HB, Proceq Factory Calibration |
| 357 13 200 | Equotip Test Block S, ~815 HLS / ~56 HRC, Proceq Factory Calibration |
| 357 14 200 | Equotip Test Block S, ~875 HLS / ~63 HRC, Proceq Factory Calibration |
| 360 04 503 | Equotip Test Block U, ~560 HLU, Proceq Factory Calibration |
| 357 41 100 | Equotip Portable Rockwell Test Block ~20 HRC, ISO 6508-3 HRC Calibration |
| 357 42 100 | Equotip Portable Rockwell Test Block ~45 HRC, ISO 6508-3 HRC Calibration |
| 357 44 100 | Equotip Portable Rockwell Test Block ~62 HRC, ISO 6508-3 HRC Calibration |

14.4 Test Blocks

| Part No. | Description |
|------------|---|
| 357 11 500 | Equotip Test Block C, ~565 HLC / <220 HB, Proceq Factory Calibration |
| 357 12 500 | Equotip Test Block C, ~665 HLC / ~325 HB, Proceq Factory Calibration |
| 357 13 500 | Equotip Test Block C, ~835 HLC / ~56 HRC, Proceq Factory Calibration |
| 357 11 100 | Equotip Test Block D/DC, <500 HLD / <220 HB, Proceq Factory Calibration |
| 357 12 100 | Equotip Test Block D/DC, ~600 HLD / ~325 HB, Proceq Factory Calibration |
| 357 13 100 | Equotip Test Block D/DC, ~775 HLD / ~56 HRC, Proceq Factory Calibration |
| 357 13 105 | Equotip Test Block D/DC, ~775 HLD, one side, Proceq Factory Calibration |
| 357 11 120 | Equotip Test Block DL, <710 HLDL / <220 HB, Proceq Factory Calibration |

| | |
|------------|---|
| 357 51 100 | Equotip UCI Test Block ~300 HV, ISO 6507-3 HV5 Calibration |
| 357 51 200 | Equotip UCI Test Block ~300 HV, ISO 6507-3 HV10 Calibration |
| 357 52 100 | Equotip UCI Test Block ~550 HV, ISO 6507-3 HV5 Calibration |
| 357 52 200 | Equotip UCI Test Block ~550 HV, ISO 6507-3 HV10 Calibration |
| 357 54 100 | Equotip UCI Test Block ~850 HV, ISO 6507-3 HV5 Calibration |
| 357 54 200 | Equotip UCI Test Block ~850 HV, ISO 6507-3 HV10 Calibration |

| | |
|------------|--|
| 357 90 929 | Equotip Leeb Test Block Additional Calibration HV, ISO 6507-3 |
| 357 90 939 | Equotip Leeb Test Block Additional Calibration HR, ISO 6508-3 |
| 357 90 918 | Equotip Portable Rockwell Test Block Additional Calibration HB, ISO 6506-3 |
| 357 90 928 | Equotip Portable Rockwell Test Block Additional Calibration HV, ISO 6507-3 |
| 357 90 940 | Equotip UCI Test Block Additional Calibration HB, ISO 6506-3 |
| 357 90 941 | Equotip UCI Test Block Additional Calibration HR, ISO 6508-3 |
| 357 90 942 | Equotip UCI Test Block Additional Calibration HV1, ISO 6507-3 |
| 357 90 943 | Equotip UCI Test Block Additional Calibration HV5, ISO 6507-3 |
| 357 90 944 | Equotip UCI Test Block Additional Calibration HV10, ISO 6507-3 |

Test Blocks Calibrations

| Part No. | Description |
|------------|--|
| 357 10 109 | Equotip Leeb Test Block Additional Calibration HLD/HLDC |
| 357 10 129 | Equotip Leeb Test Block Additional Calibration HLDL |
| 357 10 209 | Equotip Leeb Test Block Additional Calibration HLS |
| 357 10 409 | Equotip Leeb Test Block Additional Calibration HLE |
| 357 10 509 | Equotip Leeb Test Block Additional Calibration HLC |
| 357 30 309 | Equotip Leeb Test Block Additional Calibration HLG |
| 357 90 909 | Equotip Leeb Test Block Additional Calibration HL, DIN 50156-3 |
| 357 90 919 | Equotip Leeb Test Block Additional Calibration HB, ISO 6506-3 |

Proceq Europe

Ringstrasse 2
CH-8603 Schwerzenbach
Phone +41-43-355 38 00
Fax +41-43-355 38 12
info-europe@proceq.com

Proceq UK Ltd.

Bedford i-lab, Priory Business Park
Stannard Way
Bedford MK44 3RZ
United Kingdom
Phone +44-12-3483-4515
info-uk@proceq.com

Proceq USA, Inc.

117 Corporation Drive
Aliquippa, PA 15001
Phone +1-724-512-0330
Fax +1-724-512-0331
info-usa@proceq.com

Proceq Asia Pte Ltd

1 Fusionopolis Way
#02-02 Connexis South Tower
Singapore 138632
Phone +65-6382-3966
Fax +65-6382-3307
info-asia@proceq.com

Proceq Rus LLC

Ul. Optikov 4
korp. 2, lit. A, Office 410
197374 St. Petersburg
Russia
Phone + 7 812 448 35 00
info-russia@proceq.com

Proceq Middle East

P. O. Box 8365, SAIF Zone,
Sharjah, United Arab Emirates
Phone +971-6-557-8505
Fax +971-6-557-8606
info-middleeast@proceq.com

Proceq SAO Ltd.

South American Operations
Rua Paes Leme, 136, cj 610
Pinheiros, São Paulo
Brasil Cep. 05424-010
Phone +55 11 3083 38 89
info-southamerica@proceq.com

Proceq China

Unit B, 19th Floor
Five Continent International Mansion, No. 807
Zhao Jia Bang Road
Shanghai 200032
Phone +86 21-63177479
Fax +86 21 63175015
info-china@proceq.com

Subject to change. Copyright © 2017 by Proceq SA, Schwerzenbach. All rights reserved.
82035601E ver 10 2017

The Proceq logo consists of the word "proceq" in a bold, lowercase, sans-serif font. The letters are a vibrant blue color. The 'p' and 'c' are connected, and the 'e' and 'q' are also connected. The overall style is modern and professional.